



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME ARROWHEAD PINE ROSE CABINS			REINSPECTION DATE Not Specified		INSPECTOR Yvette Velasco	DATE 9/16/2015
LOCATION 25994 HWY 189 , TWIN PEAKS, CA 92391			PERMIT EXPIRATION 10/31/2015		IDENTIFIER: Spa SERVICE: 001 - INSPECTION - ROUTINE RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED	
TIME IN 2:11 PM	TIME OUT 2:29 PM	FACILITY ID FA0006883	RELATED ID PR0013925	PE 3623		

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.




88

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

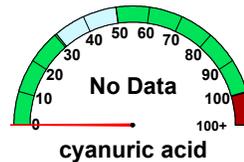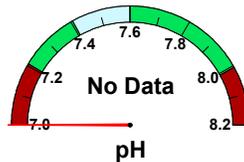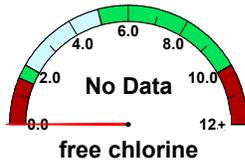

temperature (°F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K502 Water Quality - Critical – Disinfectant level



POINTS
5

Compliance Date: Not Specified
Not In Compliance
Violation Reference - HSC - 65529

Inspector Comments: Observed free chlorine levels in the spa high and above 10.0ppm.
Ensure to maintain free chlorine levels in the spa at 3.0-10.0ppm.

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm2 by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm2 the operator shall close the spray ground and water features.

36K524 Safety – Critical – Electrical hazards; GFCI



POINTS
5

Compliance Date: Not Specified
Not In Compliance
Violation Reference - HSC - 116049

Inspector Comments: Observed the GFCI non-functional.
Ensure to repair or replace the GFCI.

Violation Description: The design and installation of all underwater lighting systems, operating at more than 15 volts, supplied from a branch circuit either directly or by way of a transformer, shall be installed in a public swimming pool so that there is no shock hazard with any likely combination of fault conditions during normal use, and shall comply with both of the following requirements:

- (1) An approved ground-fault circuit interrupter shall be installed in the branch circuit that supplies all fixtures operating at more than 15 volts.
- (2) Only approved underwater lighting fixtures shall be used and no lighting fixtures shall be installed for operations at more than 150 volts between conductors.



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME ARROWHEAD PINE ROSE CABINS	DATE 9/16/2015
LOCATION 25994 HWY 189, TWIN PEAKS, CA 92391	INSPECTOR Yvette Velasco

36K518 Water Quality – Cyanuric acid concentration

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed high levels of cyanuric acid in the spa.
	Not In Compliance	Ensure to maintain cyanuric acid levels below 100.0ppm.
	Violation Reference - HSC - 65530	

Violation Description: The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

36K546 Equipment – Non-Critical - Water treatment system operation

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed the flow meter stuck.
	Not In Compliance	Ensure to repair or replace the flow meter.
	Violation Reference - HSC - 65525	

Violation Description: The pool operator shall operate pumps, filters, disinfectant and chemical feeders, flow indicators, gauges, recirculation systems, disinfection systems, and all parts of the water treatment system whenever the public pool is available for use, and at such additional times and periods as may be necessary to maintain clean pool water, clear pool water, and the disinfection standards required in section 65529 [Health and Safety Code].

36K596 Permit - Public Pool Closure

POINTS NA	Compliance Date: Not Specified	Inspector Comments: Due to high levels of free chlorine and a the electrical hazard of the non-functional GFCI the spa is closed at this time.
	Not In Compliance	Please contact the Division of Environmental Health at 1-800-442-2283 once the spa is ready to re-open.
	Violation Reference - HSC - 65545	

Description: A public pool that is maintained or operated in a manner that creates an unhealthful, unsafe, or unsanitary condition may be closed by the enforcing agent. Unhealthful, unsafe, or unsanitary conditions include, but are not limited to, failure to maintain clean pool water and clear pool water requirements; inadequate disinfection; improper pH; the presence of inhalation hazards; failure to meet microbiological or chemical water-quality standards; missing or broken suction outlet covers; missing or broken pool enclosures, including fencing and gates; hazards to pool users; and any other violation of these regulations identified by the enforcing agent. A public pool shall not be reopened until the unhealthful, unsafe, or unsanitary condition has been rectified and upon specific written approval from the enforcing agent.

Overall Inspection Comments

No summary comments have been made for this inspection.

Signature(s) of Acknowledgement

NAME:
TITLE:

Total # of Images: 0