



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dehs

FACILITY NAME RAMADA INN				DATE 6/3/2013	SIGNATURE
LOCATION 1511 E MAIN ST, BARSTOW, CA 92311				REINSPECTION DATE 12/03/2013	PERMIT EXPIRATION 12/31/2012
MAILING ADDRESS 1511 E MAIN ST, BARSTOW CA 92311				REHS Kathy Taylor	
FA # FA0006202	PR # PR0014854	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Spa
TIME IN 10:45 AM	TIME OUT 11:15 AM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine
					RESULT: 03 - Corrective Action / No Follow up Required
					ACTION: 01 - No Further Action Required

RECREATIONAL HEALTH - PUBLIC POOL/SPA



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

96

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

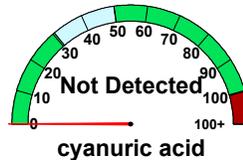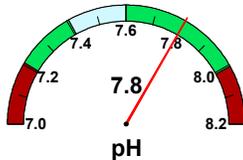

temperature (F)	100.0
observed flow (gpm)	0
required flow (gpm)	27
volume (gal)	1,700
area (sq ft)	86
occupancy	8

36K448 Equipment - Flow Meter

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 3125B

Inspector Comments: Float in flowmeter stuck and unable to determine gallons per minute rate; check and ensure at least 30 gpm is recirculating.

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K460 Skimmers - Requirements

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65533, 3136B

Inspector Comments: Provide new skimmer basket for spa; replace missing equalizer line in skimmer under float assembly.

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

Overall Inspection Comments

See flyer for new sign requirements to go into effect next pool season (2014).

Thank you

Photo Attachments:

No Photo Attachments