



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME AVENTERRA II APARTMENTS					DATE 6/27/2013	SIGNATURE	
LOCATION 16225 ARROW BL, FONTANA, CA 92335					REINSPECTION DATE 7/11/2013	PERMIT EXPIRATION 5/31/2013	
MAILING ADDRESS 16225 ARROW BL, FONTANA, CA 92335					REHS Sierra Clayborn		
FA # FA0005410	PR # PR0015970	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: pool		
TIME IN 1:28 PM	TIME OUT 2:15 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 05 - Corrective Action / Follow up Required		
					ACTION: 13 - Permit Suspended / Facility Closed		

RECREATIONAL HEALTH - PUBLIC POOL/SPA




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

82

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

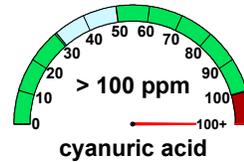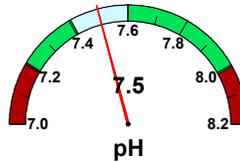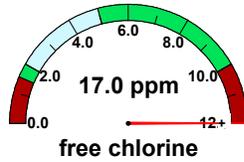

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	107
volume (gal)	38,682
area (sq ft)	1,228
occupancy	35

36K995 Permit - Suspension

⚠ CRITICAL ⚠

POINTS
NA

Compliance Date: Not Specified
Not In Compliance
Violation Reference - HSC

Inspector Comments: Pool permit suspended due to excessively high chlorine.

Violation Description: Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

36K404 Water Quality - Critical - High Disinfectant Level

⚠ CRITICAL ⚠

POINTS
4

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: Observed chlorine at 17ppm.

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K438 Enclosure - Critical - Gates Drowning Hazard

⚠ CRITICAL ⚠

POINTS
4

Compliance Date: Not Specified
Not In Compliance
Violation Reference - HSC - 3119B

Inspector Comments: Observed gate not self-latching.
Corrected:
Maintenance fixed gate during inspection.

Violation Description: Gates and doors shall be equipped with self-closing and self-latching devices. The self-latching device shall keep the gate or door securely closed. Gates and doors shall open outwardly away from the pool except where otherwise prohibited by law. Gates and doors shall be capable of being locked during times when the pool is closed. The pool enclosure shall have at least one means of egress without a key for emergency purposes.

36K418 Water Quality - Cyanurates

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: Observed cyanuric acid exceeding 100ppm.

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME AVENTERRA II APARTMENTS	DATE 6/27/2013	SIGNATURE
LOCATION 16225 ARROW BL, FONTANA, CA 92335	REHS Sierra Clayborn	

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed broken flow meter.
	Not In Compliance	
Violation Reference - CCR - 3125B		

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed missing float assembly in one skimmer.
	Not In Compliance	
Violation Reference - CCR - 65533, 3136B		

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K472 Access - Steps - Handrails - Diving Area

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed hand rails at deep end loose.
	Not In Compliance	
Violation Reference - CCR - 3111B, 3113B		

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed restrooms closed due to remodeling.
	Not In Compliance	
Violation Reference - CCR - 65535, 65551, 3117B		

Violation Description: Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments