



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

| | | | | | |
|---|----------------------------|--------------------------------|------------------------------|---------------------------------------|--|
| FACILITY NAME RADISSON ONTARIO AIRPORT | | | | DATE 7/15/2013 | SIGNATURE |
| LOCATION 2200 E HOLT BL, ONTARIO, CA 91761 | | | | REINSPECTION DATE 7/29/2013 | PERMIT EXPIRATION 8/31/2013 |
| MAILING ADDRESS 2155 E CONVENTION CENTER WY, ONTARIO CA 91764 | | | | REHS Sierra Clayborn | |
| FA # FA0006518 | PR # PR0013910 | SR # Not Specified | CO # Not Specified | PE 3601 | PROGRAM IDENTIFIER: Spa SERVICE: 001 - Inspection - Routine |
| TIME IN 4:21 PM | TIME OUT 5:01 PM | CONTACT Not Captured | | | RESULT: 05 - Corrective Action / Follow up Required ACTION: 13 - Permit Suspended / Facility Closed |

RECREATIONAL HEALTH - PUBLIC POOL/SPA



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

88

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

| |
|-------------------|
| Ideal |
| In Compliance |
| Not in Compliance |

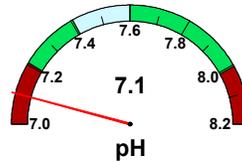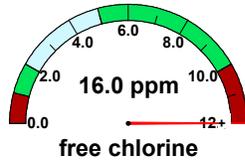

| | |
|---------------------|---------|
| temperature (F) | 102.5 |
| observed flow (gpm) | No Data |
| required flow (gpm) | No Data |
| volume (gal) | No Data |
| area (sq ft) | No Data |
| occupancy | No Data |

36K995 Permit - Suspension

⚠ CRITICAL ⚠

POINTS
NA

Compliance Date: Not Specified
Not In Compliance
Violation Reference - HSC

Inspector Comments: Spa permit suspended due to high disinfectant levels.

Violation Description: Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

36K404 Water Quality - Critical - High Disinfectant Level

⚠ CRITICAL ⚠

POINTS
4

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: Observed chlorine at 16ppm. Maintain between 1.5ppm and 10ppm.

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K446 Equipment - Chlorinator/Heater/Jets

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529, 65535, 3134B...

Inspector Comments: Observed non-functioning jets. Repair.

Violation Description: Pools, when open or in use, shall be disinfected continuously by a chemical which imparts a residual effect. Disinfectant feeders shall comply with applicable requirements established by the NSF/ANSI 50-2010 performance standard effective August 2010 for disinfectant feeders. All feeders shall be capable of supplying not less than the equivalent of 3 pounds of 100 percent available chlorine per day per 10,000 gallons of pool water capacity. All parts of the pool and related pool facilities and equipment shall be maintained in good repair. A spa pool aeration and/or jet system shall be completely separate from the recirculation system and shall not be interconnected with any other pool.

36K448 Equipment - Flow Meter

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 3125B

Inspector Comments: Observed broken flow meter. Repair.

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

| | | | |
|--|--|--------------------------------|-----------|
| FACILITY NAME RADISSON ONTARIO AIRPORT | | DATE 7/15/2013 | SIGNATURE |
| LOCATION 2200 E HOLT BL, ONTARIO, CA 91761 | | REHS Sierra Clayborn | |

36K462 Plumbing - Backflow Protection

| | | |
|--|--------------------------------|---|
| POINTS 2 | Compliance Date: Not Specified | Inspector Comments: Observed no back flow preventer on fill line for spa. Provide. |
| | Not In Compliance | |
| Violation Reference - CCR - 3141B, 3118B | | |

Violation Description: There shall be no direct connection between any potable water supply system and the pool or its piping system unless protected by a backflow prevention device in accordance with Chapter 6 of the California Plumbing Code. There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system. Potable water outlets with hose attachments shall be protected by a nonremovable hose bibb backflow preventer, a nonremovable hose bibb vacuum breaker, or by an atmospheric vacuum breaker.

36K466 Structure - Pool Shell

| | | |
|-----------------------------------|--------------------------------|--|
| POINTS 2 | Compliance Date: Not Specified | Inspector Comments: Observed chipped plaster on seat and steps. Repair. |
| | Not In Compliance | |
| Violation Reference - CCR - 3108B | | |

Violation Description: The finished pool shell shall be lined with a smooth waterproof interior finish that will withstand repeated brushing, scrubbing, and cleaning procedures. The finish color shall be white. Tiles installed at the waterline shall be of contrasting color. A spa pool may be finished in a light color other than white when approved by the enforcing agent. Pool shell shall be maintained in good repair.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments