



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME SONRISA HOMEOWNERS ASSOCIATION					DATE 7/30/2013	SIGNATURE	
LOCATION 13292 SUNNYSLOPE DR, CHINO HILLS, CA 91710					REINSPECTION DATE 1/30/2014	PERMIT EXPIRATION 6/30/2014	
MAILING ADDRESS PO BOX 5022, UPLAND CA 91785					REHS Tin Nguyen		
FA # FA0005220	PR # PR0015125	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Pool		
TIME IN 3:18 PM	TIME OUT 3:49 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 03 - Corrective Action / No Follow up Required		
					ACTION: 01 - No Further Action Required		

RECREATIONAL HEALTH - PUBLIC POOL/SPA




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

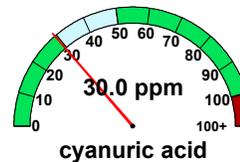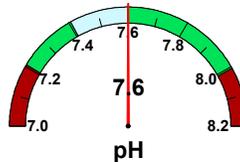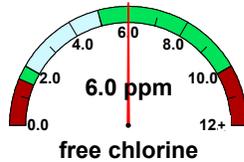

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	50
volume (gal)	17,952
area (sq ft)	600
occupancy	30

36K448 Equipment - Flow Meter

POINTS
2

Compliance Date: Not Specified
 Not In Compliance
 Violation Reference - CCR - 3125B

Inspector Comments:
 -Observed flow meter stuck. Repair/replace.

NOTE:
 -Maintain flow rate at 50 gpm.

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K460 Skimmers - Requirements

POINTS
2

Compliance Date: Not Specified
 Not In Compliance
 Violation Reference - CCR - 65533, 3136B

Inspector Comments:
 -Observed weir gate missing in pool skimmer near pool steps. Repair/replace.
 -Observed float assembly missing in pool skimmer near pool steps. Repair/replace.

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K472 Access - Steps - Handrails - Diving Area

POINTS
2

Compliance Date: Not Specified
 Not In Compliance
 Violation Reference - CCR - 3111B, 3113B

Inspector Comments: Observed loose handrails in pool near pool steps. Repair/replace handrails.

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

Overall Inspection Comments

pH: 7.6
 Chlorine: 6.0 ppm
 CYA: 30 ppm
 Flow rate: n/a

Photo Attachments:
 No Photo Attachments