



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME LOMA LINDA VILLAGE HOA					DATE 5/13/2014	SIGNATURE	
LOCATION 10196 AMBROSIA WY, SAN BERNARDINO, CA 92408					REINSPECTION DATE Not Specified	PERMIT EXPIRATION 3/31/2015	
MAILING ADDRESS PO BOX490, UPLAND CA 91785					REHS Yong Aday		
FA # FA0004653	PR # PR0015255	SR # Not Specified	CO # Not Specified	PE 3605	PROGRAM IDENTIFIER: Spa		
TIME IN 10:54 AM	TIME OUT 11:11 AM	CONTACT Not Captured			SERVICE: 001 - INSPECTION - ROUTINE		
					RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ		
					ACTION: 01 - NO FURTHER ACTION REQUIRED		



RECREATIONAL HEALTH - PUBLIC SPA

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

92

SCORE

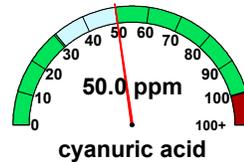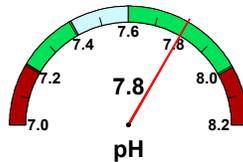

temperature (F)	104.0
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	7

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed stuck flow meter. Clean, repair or replace the meter as needed, and ensure proper flow rate.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K454 Maintenance - Cleanliness

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed debris accumulated on spa shell.
	Not In Compliance	
	Violation Reference - CCR - 65533	

Violation Description: Floating scum, sputum or debris shall not be allowed to accumulate in the pool. The bottom and sides of the pool shall be cleaned as often as necessary to be kept in a clean condition. The sides and bottom of pools, decks and other surfaces shall be kept free of slime and algae.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed wrong type of float assembly in the skimmer. Replace it with the ball-shape type of float assembly.
	Not In Compliance	
	Violation Reference - CCR - 65533, 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K478 Disposal - Wastewater

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed the separation tank drain pipe directed to floor of the pump room. Provide indirect connection (with an air gap) from the pipe to sewer line.
	Not In Compliance	
	Violation Reference - CCR 24 - 3141B	

Violation Description: Material cleaned from filters and backwash water from any recirculation system shall be disposed in a manner that is acceptable to the local wastewater agency and will not create a nuisance.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments