



**County of San Bernardino • Department of Public Health  
Division of Environmental Health Services  
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM  
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

**(800) 442-2283**

FACILITY NAME <b>AYRES HOTEL</b>					DATE <b>5/16/2014</b>	SIGNATURE	
LOCATION <b>4785 CHINO HILLS PKWY, CHINO HILLS, CA 91709</b>					REINSPECTION DATE <b>5/30/2014</b>	PERMIT EXPIRATION <b>6/30/2014</b>	
MAILING ADDRESS <b>355 BRISTOL ST STE A, COSTA MESA CA 92626</b>					REHS <b>Tin Nguyen</b>		
FA # <b>FA0017188</b>	PR # <b>PR0023204</b>	SR # <b>Not Specified</b>	CO # <b>Not Specified</b>	PE <b>3601</b>	PROGRAM IDENTIFIER: POOL SERVICE: 001 - INSPECTION - ROUTINE		
TIME IN <b>12:21 PM</b>	TIME OUT <b>1:00 PM</b>	CONTACT <b>Not Captured</b>			RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQUIRED ACTION: 03 - REINSPECTION REQUIRED		

**RECREATIONAL HEALTH - PUBLIC POOL**




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

**90**

SCORE

Ideal
In Compliance
Not in Compliance

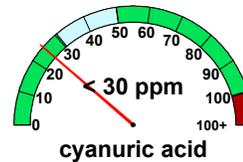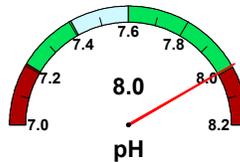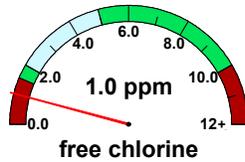

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

**36K438 Enclosure - Critical - Gates Drowning Hazard**

**⚠ CRITICAL ⚠**

<b>POINTS</b> <b>4</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> -Observed gate closest to pump room not self-latching. Ensure gate to spa/pool is self-closing and self-latching.  NOTE: -Maintenance was present at facility at time of inspection and locked gate closest to pump room so that entry is prohibited. -Facility has another entrance to spa/pool that will remain accessible to patrons, and gate closest to pump room shall be locked, until gate is self-latching. -Will return in 2-3 days to follow-up on proper closure of gate closest to pump room. Ensure gate properly self-latches. Non-compliance may result in future re-inspection at \$245.00 per hour.
	Not In Compliance Violation Reference - HSC - 3119B	

**Violation Description:** Gates and doors shall be equipped with self-closing and self-latching devices. The self-latching device shall keep the gate or door securely closed. Gates and doors shall open outwardly away from the pool except where otherwise prohibited by law. Gates and doors shall be capable of being locked during times when the pool is closed. The pool enclosure shall have at least one means of egress without a key for emergency purposes.

**36K427 Safety - Safety Signs**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed the following safety signs missing at spa: -Closure sign on gate farthest from pump room -Facility address and telephone number of nearest emergency facility -Improper sizing of CPR sign. Ensure CPR sign is at least four inches in font size.
	Not In Compliance Violation Reference - CCR 24 - 3120B	

**Violation Description:** All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- Maximum number of pool users permitted for each pool.
- "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- A warning sign for spa pools with "CAUTION" language.
- Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP GATE CLOSED" or "KEEP DOOR CLOSED".
- A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."



County of San Bernardino • Department of Public Health  
 Division of Environmental Health Services  
**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM**  
**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

(800) 442-2283

FACILITY NAME <b>AYRES HOTEL</b>	DATE <b>5/16/2014</b>	SIGNATURE
LOCATION 4785 CHINO HILLS PKWY, CHINO HILLS, CA 91709		REHS <b>Tin Nguyen</b>

**36K460 Skimmers - Requirements**

<b>POINTS</b>	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 65533, 3136B	<b>Inspector Comments:</b> -Observed broken/detached float assembly in skimmer at five feet of pool. Repair/replace float assembly in skimmer. -Observed spring valve missing in skimmer at five feet of pool. Replace spring valve to skimmer. -Observed weir gate missing in skimmer at three and a half feet of pool. Replace weir gate in skimmer.
---------------	---	---

**Violation Description:** The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

**36K472 Access - Steps - Handrails - Diving Area**

<b>POINTS</b>	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 3111B, 3113B	<b>Inspector Comments:</b> Observed hand rails loose. Tighten loose hand rails.
---------------	---	---

**Violation Description:** Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Photo Attachments:**

No Photo Attachments