



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME HESPERIA MOTEL 6					DATE 7/15/2014	SIGNATURE	
LOCATION 9757 CATABA RD, HESPERIA, CA 92345					REINSPECTION DATE Not Specified	PERMIT EXPIRATION 6/30/2014	
MAILING ADDRESS 9757 CATABA RD, HESPERIA CA 92345					REHS Melissa Nano		
FA # FA0016201	PR # PR0021549	SR # Not Specified	CO # Not Specified	PE 3623	PROGRAM IDENTIFIER: Spa SERVICE: 001 - INSPECTION - ROUTINE		
TIME IN 10:21 AM	TIME OUT 11:10 AM	CONTACT Not Captured			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ ACTION: 01 - NO FURTHER ACTION REQUIRED		

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

94

SCORE

Ideal
In Compliance
Not in Compliance

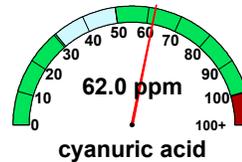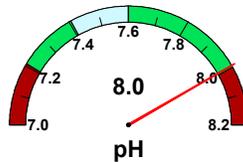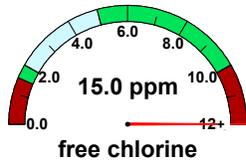

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	30
volume (gal)	900
area (sq ft)	39
occupancy	4

36K404 Water Quality - Critical - High Disinfectant Level



POINTS 4	Compliance Date: Not Specified	Inspector Comments: Observed chlorine level high with a reading over 15 ppm. Maintenance on site corrected to a new reading of 1.5 ppm. Maintain chlorine between 1.5 and 10 ppm with a recommended and ideal concentration between 2 and 4 ppm.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K474 Lighting - Adequate Lighting and Ventilation

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Repair non-operating underwater light fixture. Ensure GFI is properly working.
	Not In Compliance	
	Violation Reference - SBCC - 3115B, 3106B, 3121B	

Violation Description: Pools used at night shall be equipped with underwater lighting fixtures that will provide complete illumination to all underwater areas of the pool with no blind spots. Pool deck areas and emergency egress areas shall be provided with lighting so that persons walking on the deck can identify hazards. Lighting fixtures shall be aimed towards the deck area and away from the pool surface insofar as practical. Artificial lighting shall be provided at all spray ground pads which are used at night or which do not have adequate natural lighting so that all portions of the spray pad and deck may be seen easily.

Indoor pools, dressing rooms and toilet rooms shall be ventilated according to the requirements in Chapter 4 of the California Mechanical Code.

Overall Inspection Comments

Refer to pool inspection report for common area violations.

Photo Attachments:

No Photo Attachments