



County of San Bernardino • Department of Public Health  
 Division of Environmental Health Services  
**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM**  
**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

(800) 442-2283

FACILITY NAME <b>MT BALDY LODGE</b>				DATE <b>9/9/2014</b>	SIGNATURE 
LOCATION <b>6777 MT BALDY RD, MT BALDY, CA 91759</b>				REINSPECTION DATE <b>Not Specified</b>	PERMIT EXPIRATION <b>7/31/2015</b>
MAILING ADDRESS <b>PO BOX 699, MT BALDY CA 91759</b>				REHS <b>Shannon Johnson</b>	
FA # <b>FA0007278</b>	PR # <b>PR0014673</b>	SR # <b>Not Specified</b>	CO # <b>Not Specified</b>	PE <b>3620</b>	PROGRAM IDENTIFIER: Pool
TIME IN <b>2:45 PM</b>	TIME OUT <b>3:30 PM</b>	CONTACT <b>Not Captured</b>			SERVICE: 001 - INSPECTION - ROUTINE
					RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ
					ACTION: 01 - NO FURTHER ACTION REQUIRED

**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

**92**

SCORE

Ideal
In Compliance
Not in Compliance

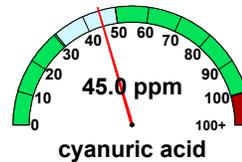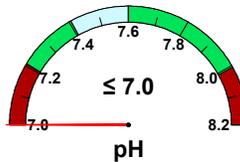

temperature (F)	80.0
observed flow (gpm)	No Data
required flow (gpm)	90
volume (gal)	43,560
area (sq ft)	1,012
occupancy	48

**36K414 Water Quality - Non-Critical - pH High/Low**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed the pH to be 7
	Not In Compliance	
	Violation Reference - CCR - 65529	

**Violation Description:** Water shall be maintained in an alkaline condition at a pH between 7.2 and 8.0.

**36K444 Equipment - Recirculation Pump/Filter/Separation Tank**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no directional symbols on piping on the equipment/pump enclosure.
	Not In Compliance	
	Violation Reference - HSC - 3120B, 3132B, 3141B	

**Violation Description:** Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

**36K448 Equipment - Flow Meter**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed the flow meter to be inoperable.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

**Violation Description:** A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

**36K476 Decking - Requirements**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed part of the deck to be damaged at the return line under the diving board.
	Not In Compliance	
	Violation Reference - CCR - 3114B	

**Violation Description:** A minimum continuous and unobstructed 4-foot wide slip resistant, cleanable, nonabrasive deck area of concrete or like material shall be provided flush with the top of the pool coping extending completely around the pool, and the deck area shall further extend 4 feet both sides and rear of any diving board, fixed disabled access assistance device or slide and their appurtenances. Deck shall be maintained in good repair.

**Overall Inspection Comments**

No summary comments have been made for this inspection.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM  
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

**(800) 442-2283**

FACILITY NAME MT BALDY LODGE	DATE 9/9/2014	SIGNATURE 
LOCATION 6777 MT BALDY RD, MT BALDY, CA 91759		REHS Shannon Johnson

**Photo Attachments:**

No Photo Attachments