



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

| | | | | | |
|---|----------------------------|---------------------------------|---|---|--|
| FACILITY NAME SUNRIDGE PINES APARTMENTS III | | | REINSPECTION DATE Not Specified | INSPECTOR Brad Larson | DATE 8/25/2016 |
| LOCATION 9920 19TH ST, RANCHO CUCAMONGA, CA 91701 | | | PERMIT EXPIRATION 12/31/2016 | IDENTIFIER: Spa - West SERVICE: 001 - INSPECTION - ROUTINE | |
| TIME IN 12:45 PM | TIME OUT 1:15 PM | FACILITY ID FA0004825 | RELATED ID PR0015214 | PE 3623 | RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED |

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility


Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional inspection to be billed at the hourly rate as provided in the San Bernardino County Code, [Schedule of Fees](#).

89
SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

| |
|-------------------|
| Ideal |
| In Compliance |
| Not in Compliance |

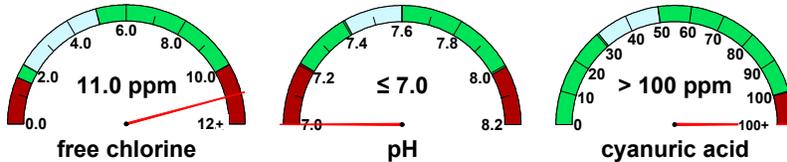

| | |
|---------------------|---------|
| temperature (°F) | No Data |
| observed flow (gpm) | No Data |
| required flow (gpm) | 59 |
| volume (gal) | 1,766 |
| area (sq ft) | 78 |
| occupancy | 7 |

IMPORTANT: Replacement of Suction Outlet Covers
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K502 Water Quality - Critical – Disinfectant level ⚠️ CRITICAL ⚠️

| | | |
|---------------------------|--|--|
| POINTS 5 | Compliance Date: Not Specified Not In Compliance Violation Reference - HSC - 65529 | Inspector Comments: Free active chlorine greater than 10. Chlorine neutralizer was added to the spa pool. (And soda ash) |
|---------------------------|--|--|

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm2 by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm2 the operator shall close the spray ground and water features.

36K506 Water Quality - Critical – Water pH 7.2 to 7.8 ⚠️ CRITICAL ⚠️

| | | |
|---------------------------|--|---|
| POINTS 5 | Compliance Date: Not Specified Not In Compliance Violation Reference - HSC - 65530 | Inspector Comments: pH was observed to be 6.83. Soda ash was added to the pool. |
|---------------------------|--|---|

Violation Description: The pool operator shall maintain public pool water at pH 7.2 to 7.8.

36K552 Equipment - Flow meter provided

| | | |
|---------------------------|---|--|
| POINTS 1 | Compliance Date: Not Specified Not In Compliance Violation Reference - CCR 24 - 3125B.3 | Inspector Comments: The flow rate was not observed as the flow meter was unreadable. Repair or replace the flow meter. |
|---------------------------|---|--|

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow and installed according to the manufacturer's written instructions with increments in the range of normal flow.

Overall Inspection Comments



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

| | |
|--|--------------------------|
| FACILITY NAME SUNRIDGE PINES APARTMENTS III | DATE 8/25/2016 |
| LOCATION 9920 19TH ST, RANCHO CUCAMONGA, CA 91701 | INSPECTOR Brad Larson |

The spa pool was not posted closed as the pool operator added soda ash and chlorine neutralizer during the inspection. Influent 25; Effluent 20 psi. pH was adjusted to 7.6;

Signature(s) of Acknowledgement

NAME: Joel Bera
TITLE: Maintenance supervisor

Total # of Images: 0