



Public Health
Environmental Health Services

www.SBCounty.gov

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MILL CREEK APARTMENT HOMES			DATE 8/20/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 5/31/2016
LOCATION 2020 N GUTHRIE ST, SAN BERNARDINO, CA 92404				INSPECTOR Sierra Clayborn	
MAILING ADDRESS 2900 ADAMS ST STE C200, RIVERSIDE CA 92504			<input type="checkbox"/> FACILITY <input type="checkbox"/> OWNER <input checked="" type="checkbox"/> ACCOUNT IDENTIFIER: Spa SERVICE: 001 - INSPECTION - ROUTINE RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU ACTION: 03 - REINSPECTION REQUIRED		
TIME IN 11:30 AM	TIME OUT 12:03 PM	FACILITY ID FA0008885	RELATED ID PR0016012	PE 3623	

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.



92

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

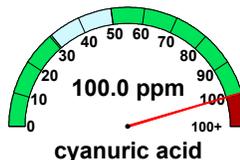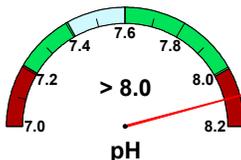

temperature (°F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	32
volume (gal)	950
area (sq ft)	50
occupancy	5

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:
 1. Meet the latest ANSI/APSP-16 performance standard
 2. Be rated for the maximum designed flow-rate of the pump
 Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K524 Safety – Critical – Electrical hazards; GFCI ⚠ CRITICAL ⚠

POINTS 5	Compliance Date: Not Specified	Inspector Comments: Observed underwater spa light functioning and GFCI attached not functioning. Ensure that GFCI is functioning properly. Investigate/Repair IMMEDIATELY. Inspector will return to reinspect in 1 week.
	Not In Compliance	
	Violation Reference - HSC - 116049	

Violation Description: The design and installation of all underwater lighting systems, operating at more than 15 volts, supplied from a branch circuit either directly or by way of a transformer, shall be installed in a public swimming pool so that there is no shock hazard with any likely combination of fault conditions during normal use, and shall comply with both of the following requirements:
 (1) An approved ground-fault circuit interrupter shall be installed in the branch circuit that supplies all fixtures operating at more than 15 volts.
 (2) Only approved underwater lighting fixtures shall be used and no lighting fixtures shall be installed for operations at more than 150 volts between conductors.

36K508 Water Quality – Non-Critical – Water pH 7.2 to 7.8

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed pH at 8.1. Maintain pH between 7.2 and 7.8.
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The pool operator shall maintain public pool water at pH 7.2 to 7.8.



Public Health

Environmental Health Services

www.SBCounty.gov

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MILL CREEK APARTMENT HOMES	DATE 8/20/2015
LOCATION 2020 N GUTHRIE ST, SAN BERNARDINO, CA 92404	INSPECTOR Sierra Clayborn

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K548 Equipment - General Requirements - System Description

POINTS 1	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR 24 - 3123B.1	Inspector Comments: Observed flow meter bobbin corroded and stuck in column. Repair/clean. Observed spa heater and jets not functioning during inspection. Repair/replace by next routine inspection.
--------------------	---	--

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The system shall consist of pumps, filters, chemical feeders, skimmers or perimeter overflow systems, valves, pipes, connections, fittings and appurtenances.

36K562 Skimmers - Pool skimming systems

POINTS 1	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 3136B	Inspector Comments: Observed spring assembly/check valve missing from spa skimmer. Replace.
--------------------	--	--

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 100 percent of the flow rate. Each surface skimmer shall comply with the requirements in accordance with section 3136B, Title 24, California Code of Regulations.

Overall Inspection Comments

Ensure that GFCI is functioning properly. Investigate/Repair IMMEDIATELY.
Inspector will return to reinspect in 1 week.

Signature(s) of Acknowledgement

NAME: Shantel Del Rosario
TITLE: Assistant Manager

Total # of Images: 0