



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME LA FITNESS		REINSPECTION DATE Not Specified		INSPECTOR Karen Vu	DATE 6/8/2016
LOCATION 9385 MONTE VISTA RD, MONTCLAIR, CA 91763				PERMIT EXPIRATION 11/30/2015	IDENTIFIER: Pool
TIME IN 2:20 PM	TIME OUT 3:10 PM	FACILITY ID FA0008507	RELATED ID PR0014483	PE 3620	SERVICE: 001 - INSPECTION - ROUTINE
					RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU
					ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional inspection to be billed at the hourly rate as provided in the San Bernardino County Code, [Schedule of Fees](#).

92
SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

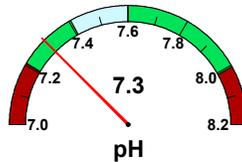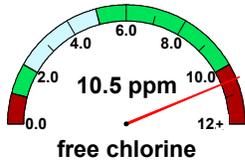

temperature (°F)	No Data
observed flow (gpm)	110
required flow (gpm)	150
volume (gal)	54,000
area (sq ft)	1,800
occupancy	90

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K995 Permit - Suspension



POINTS
NA

Compliance Date: **Not Specified**
Not In Compliance
Violation Reference - HSC

Inspector Comments: The pool is closed due to a loose under water light fixture that can cause a potential shock hazard. Call (800) 442- 2283 for a re-inspection.

Violation Description: Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

36K524 Safety – Critical – Electrical hazards; GFCI



POINTS
5

Compliance Date: **Not Specified**
Not In Compliance
Violation Reference - HSC - 116049

Inspector Comments: Observed loose under water light (with a 1 inch gap) in the center of the pool on the side nearest the window.

Secure under water light to prevent potential shock hazard.

Violation Description: The design and installation of all underwater lighting systems, operating at more than 15 volts, supplied from a branch circuit either directly or by way of a transformer, shall be installed in a public swimming pool so that there is no shock hazard with any likely combination of fault conditions during normal use, and shall comply with both of the following requirements:

- (1) An approved ground-fault circuit interrupter shall be installed in the branch circuit that supplies all fixtures operating at more than 15 volts.
- (2) Only approved underwater lighting fixtures shall be used and no lighting fixtures shall be installed for operations at more than 150 volts between conductors.



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME LA FITNESS	DATE 6/8/2016
LOCATION 9385 MONTE VISTA RD, MONTCLAIR, CA 91763	INSPECTOR Karen Vu

36K504 Water Quality – Non-Critical – Disinfectant level low

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed free chlorine residual at 10.5ppm.
	Not In Compliance	
	Violation Reference - HSC - 65529	Lower and maintain free chlorine between 1.0-10.0ppm without stabilizer.

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

36K527 Safety – Safety signs

POINTS 1	Compliance Date: Not Specified	Inspector Comments: a. Observed missing maximum capacity number on the safety sign.
	Not In Compliance	Provide the maximum capacity number for the pool.
	Violation Reference - CCR - 3120B	b. Observed missing nearest emergency phone number. Provide nearest emergency phone number in clear site.

Violation Description: All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- Maximum number of pool users permitted for each pool.
- ""NO DIVING"" at pools with a maximum water depth of 6 feet or less.
- Where no lifeguard service is provided, a warning sign shall be posted stating, ""WARNING: NO LIFEGUARD ON DUTY."" The sign also shall state in letters at least 1 inch high, ""Children under the age of 14 shall not use pool without a parent or adult guardian in attendance.""
- An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- A warning sign for spa pools with ""CAUTION"" language.
- Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, ""NO USE OF POOL ALLOWED AFTER DARK.""
- A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, ""KEEP GATE CLOSED"" or ""KEEP DOOR CLOSED"".
- A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, ""CAUTION: WATER IS RECIRCULATED. DO NOT DRINK.""

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed loose grab rails from the pool nearest the spa and also nearest the life ring.
	Not In Compliance	
	Violation Reference - HSC - 65535	Secure loose grab rails.

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

36K596 Permit - Public Pool Closure

POINTS NA	Compliance Date: Not Specified	Inspector Comments: The pool is closed due to a loose under water light fixture that can cause a potential shock hazard. Call (800) 442- 2283 for a re-inspection.
	Not In Compliance	
	Violation Reference - HSC - 65545	

Description: A public pool that is maintained or operated in a manner that creates an unhealthful, unsafe, or unsanitary condition may be closed by the enforcing agent. Unhealthful, unsafe, or unsanitary conditions include, but are not limited to, failure to maintain clean pool water and clear pool water requirements; inadequate disinfection; improper pH; the presence of inhalation hazards; failure to meet microbiological or chemical water-quality standards; missing or broken suction outlet covers; missing or broken pool enclosures, including fencing and gates; hazards to pool users; and any other violation of these regulations identified by the enforcing agent. A public pool shall not be reopened until the unhealthful, unsafe, or unsanitary condition has been rectified and upon specific written approval from the enforcing agent.



RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME LA FITNESS	DATE 6/8/2016
LOCATION 9385 MONTE VISTA RD, MONTCLAIR, CA 91763	INSPECTOR Karen Vu

Overall Inspection Comments

No summary comments have been made for this inspection.

Signature(s) of Acknowledgement

NAME: Rafa Serfaty (Operations Manager)
TITLE:

Total # of Images: 0