



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME SPRING VALLEY LAKE COUNTRY CLUB		DATE 8/11/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 12/31/2015
LOCATION 13229 SPRING VALLEY LAKE PKWY, VICTORVILLE, CA 92392			INSPECTOR Melissa Nano	
MAILING ADDRESS 7070 SVL BOX, VICTORVILLE CA 92392			IDENTIFIER: Spa	
TIME IN 4:21 PM	TIME OUT 5:27 PM	FACILITY ID FA0006828	RELATED ID PR0014767	PE 3623
			SERVICE: 001 - INSPECTION - ROUTINE RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED	

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.




93

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

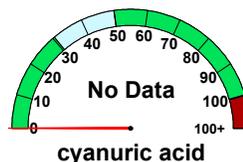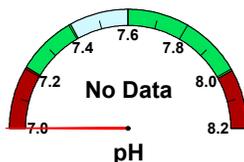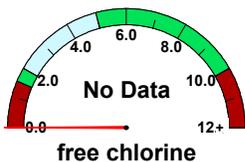

temperature (°F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	35
volume (gal)	791
area (sq ft)	47
occupancy	4

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K502 Water Quality - Critical – Disinfectant level ⚠️ CRITICAL ⚠️

POINTS 5	Compliance Date: Not Specified	Inspector Comments:
	Not In Compliance	Maintain spa chlorine concentration between 3ppm and 10ppm.
	Violation Reference - HSC - 65529	Observed chlorine significantly above 10ppm. Spa shall remain closed until verified compliance.

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm² by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm² the operator shall close the spray ground and water features.

36K556 Equipment – Plumbing labeled

POINTS 1	Compliance Date: Not Specified	Inspector Comments:
	Not In Compliance	Label and indicate, using arrows, the direction of flow of water onto recirculation piping.
	Violation Reference - CCR 24 - 3120B	Observed missing.

Violation Description: The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME SPRING VALLEY LAKE COUNTRY CLUB	DATE 8/11/2015
LOCATION 13229 SPRING VALLEY LAKE PKWY, VICTORVILLE, CA 92392	INSPECTOR Melissa Nano

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K562 Skimmers - Pool skimming systems

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Obtain weir gate skimmers system to properly skim water. Observed missing.
	Not In Compliance	
	Violation Reference - CCR - 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 100 percent of the flow rate. Each surface skimmer shall comply with the requirements in accordance with section 3136B, Title 24, California Code of Regulations.

36K596 Permit - Public Pool Closure

POINTS NA	Compliance Date: Not Specified	Inspector Comments: The spa shall be closed for the following reason(s): 1. Chlorine exceed 10ppm. Spa shall remain closed until authorized and verified by DEHS.
	Not In Compliance	
	Violation Reference - HSC - 65545	

Description: A public pool that is maintained or operated in a manner that creates an unhealthful, unsafe, or unsanitary condition may be closed by the enforcing agent. Unhealthful, unsafe, or unsanitary conditions include, but are not limited to, failure to maintain clean pool water and clear pool water requirements; inadequate disinfection; improper pH; the presence of inhalation hazards; failure to meet microbiological or chemical water-quality standards; missing or broken suction outlet covers; missing or broken pool enclosures, including fencing and gates; hazards to pool users; and any other violation of these regulations identified by the enforcing agent. A public pool shall not be reopened until the unhealthful, unsafe, or unsanitary condition has been rectified and upon specific written approval from the enforcing agent.

Overall Inspection Comments

Spa shall remain closed until verified by DEHS.

If there are any questions, please contact Environmental Health Services or Melissa Nano at (800) 442-2283.

Signature(s) of Acknowledgement

NAME: Wayne B.
 TITLE:

Total # of Images: 0