



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME RESIDENCE INN BY MARRIOTT		DATE 5/4/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 8/31/2015
LOCATION 2025 CONVENTION CENTER WY, ONTARIO, CA 91764			INSPECTOR John Ramos	
MAILING ADDRESS 50 COCONUT ROW STE 200, PALM BEACH FL 33480		<input type="checkbox"/> FACILITY <input type="checkbox"/> OWNER <input checked="" type="checkbox"/> ACCOUNT IDENTIFIER: Spa SERVICE: 001 - INSPECTION - ROUTINE RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE ACTION: 01 - NO FURTHER ACTION REQUIRED		
TIME IN 3:53 PM	TIME OUT 4:46 PM	FACILITY ID FA0006599	RELATED ID PR0015913	PE 3623



RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

95
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

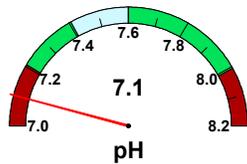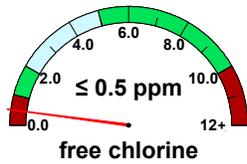

temperature (°F)	105.1
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K504 Water Quality – Non-Critical – Disinfectant level low

POINTS 1	Comply by: 5/4/2015	Inspector Comments: Observed 0.53 ppm chlorine residual. Maintain 1.0 ppm to 10.0 ppm chlorine residual. Corrected to 1.58 ppm.
	Complied on 5/4/2015	
	Violation Reference - HSC - 65529	

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

36K508 Water Quality – Non-Critical – Water pH 7.2 to 7.8

POINTS 1	Comply by: 5/4/2015	Inspector Comments: Observed pH at 7.1. Maintain pH at 7.2 to 7.8. Corrected to 7.2.
	Complied on 5/4/2015	
	Violation Reference - HSC - 65530	

Violation Description: The pool operator shall maintain public pool water at pH 7.2 to 7.8.

36K516 Water Quality – Non-Critical – Water clarity

POINTS 1	Comply by: 5/4/2015	Inspector Comments: Observed cloudy water in the spa. Maintain clear water. Corrected once the cause of the cloudiness was determined. Cloudiness caused by adding DE to the skimmer without removing the float assembly. Cleared by removing float assembly and brushing the bottom of the spa.
	Complied on 5/4/2015	
	Violation Reference - HSC - 65527	

Violation Description: The pool operator shall maintain clear pool water while the public pool is in use. The pool operator shall close the public pool if the bottom of the pool at the maximum depth is not clearly visible from the deck. The pool operator shall not reopen the public pool for use until the pool water is clean and clear, and the bottom of the pool at the maximum depth is clearly visible from the deck. If the bottom of the pool is not visible 48 hours following inspection and closure by the enforcing agent, the enforcing agent may order the pool drained.



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME RESIDENCE INN BY MARRIOTT	DATE 5/4/2015
LOCATION 2025 CONVENTION CENTER WY, ONTARIO, CA 91764	INSPECTOR John Ramos

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K528 Safety – Safety equipment

POINTS 1	Comply by: 5/18/2015	Inspector Comments: Observed one life ring with a frayed ring rope. Replace with an approved life ring.
	Not In Compliance	
	Violation Reference - HSC - 65540	

Violation Description: Except for spray grounds without standing water, the pool operator shall ensure that the following safety and first aid equipment is provided and maintained readily visible and available for use at the public pool at all times:

- (1) A 17-inch-minimum (exterior diameter) life ring with an attached throw rope with a minimum 3/16-inch diameter. The throw rope shall be of sufficient length to span the maximum width of the public pool and shall be stored in such a way as to prevent kinking or fouling.
- (2) A 12-foot-minimum fixed-length rescue pole with a permanently attached body hook. For spas, the length of the rescue pole shall be of sufficient length to effectuate rescue.

For public pools that exceed 75 feet in length or 50 feet in width, the pool operator shall provide a rescue pole and a life ring on at least two opposing sides of the public pool at centralized locations.

For public pools with lifeguard personnel on duty, the pool operator of each public pool area shall have the following additional safety equipment:

- (1) A Red Cross 10-Person Industrial First Aid Kit or the equivalent.
- (2) An operating telephone.
- (3) A backboard and head immobilizer.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Comply by: 5/18/2015	Inspector Comments: Observed flow meter not working and the flow and turnover rate cannot be determined. Repair flow meter.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments

Correct the above noted violations.

Note: GFCI located in circuit breaker panel.

Signature(s) of Acknowledgement

NAME:
TITLE:

Total # of Images: 0