



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME TREE TOP LODGE		DATE 8/25/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 7/31/2016
LOCATION 27992 RAINBOW DR, LAKE ARROWHEAD, CA 92352			INSPECTOR Yvette Velasco	
MAILING ADDRESS PO BOX 186, LAKE ARROWHEAD CA 92352			IDENTIFIER: Pool	
TIME IN 12:12 PM	TIME OUT 1:04 PM	FACILITY ID FA0006788	RELATED ID PR0013615	PE 3620
			SERVICE: 001 - INSPECTION - ROUTINE RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQU ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED	

**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$4.08 per 1 minute with a minimum time of 30 minutes, and a minimum charge of \$122.50.



**87**

SCORE

Administrative Order to Show Cause (OSC): The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked; otherwise the right to a hearing shall be deemed waived.

See the following pages for the code sections and general requirements that correspond to each violation listed below.

Ideal
In Compliance
Not in Compliance

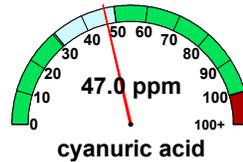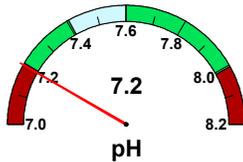

temperature (°F)	83.0
observed flow (gpm)	No Data
required flow (gpm)	41
volume (gal)	15,000
area (sq ft)	510
occupancy	17

**IMPORTANT: Replacement of Suction Outlet Covers**  
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K502 Water Quality - Critical – Disinfectant level** ⚠️ CRITICAL ⚠️

<b>POINTS</b> <b>5</b>	Compliance Date: Not Specified	Inspector Comments: Observed free chlorine levels in the pool at 0ppm.
	Not In Compliance	Ensure to maintain free chlorine levels in the pool at 2.0-10.0ppm, with cyanuric acid.
	Violation Reference - HSC - 65529	

**Violation Description:** The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm2 by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm2 the operator shall close the spray ground and water features.

**36K524 Safety – Critical – Electrical hazards; GFCI** ⚠️ CRITICAL ⚠️

<b>POINTS</b> <b>5</b>	Compliance Date: Not Specified	Inspector Comments: Observed the GFCI non-functional.
	Not In Compliance	Ensure to repair or replace the GFCI for the light fixture inside of the pool.
	Violation Reference - HSC - 116049	

**Violation Description:** The design and installation of all underwater lighting systems, operating at more than 15 volts, supplied from a branch circuit either directly or by way of a transformer, shall be installed in a public swimming pool so that there is no shock hazard with any likely combination of fault conditions during normal use, and shall comply with both of the following requirements:

- (1) An approved ground-fault circuit interrupter shall be installed in the branch circuit that supplies all fixtures operating at more than 15 volts.
- (2) Only approved underwater lighting fixtures shall be used and no lighting fixtures shall be installed for operations at more than 150 volts between conductors.



## Public Health Environmental Health Services

[www.SBCounty.gov](http://www.SBCounty.gov)

### RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME TREE TOP LODGE	DATE 8/25/2015
LOCATION 27992 RAINBOW DR, LAKE ARROWHEAD, CA 92352	INSPECTOR Yvette Velasco

#### IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

#### 36K546 Equipment – Non-Critical - Water treatment system operation

POINTS <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Observed no float assembly device provided in the top skimmer.  Ensure to provide float assembly device.
	Not In Compliance	
	Violation Reference - HSC - 65525	

**Violation Description:** The pool operator shall operate pumps, filters, disinfectant and chemical feeders, flow indicators, gauges, recirculation systems, disinfection systems, and all parts of the water treatment system whenever the public pool is available for use, and at such additional times and periods as may be necessary to maintain clean pool water, clear pool water, and the disinfection standards required in section 65529 [Health and Safety Code].

#### 36K560 Equipment – Waste water

POINTS <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Observed an insufficient air gap at the backwash drain.  Ensure to maintain a minimum one inch air gap at the backwash drain and pipe.
	Not In Compliance	
	Violation Reference - CCR - 3141B	

**Violation Description:** There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system.

Material cleaned from filters and backwash water from any recirculation system shall be disposed in a manner that is acceptable to the local wastewater agency and will not create a nuisance. Backwash water shall not be returned to a pool. Pipes carrying wastewater from pools including pool drainage and backwash from filters shall be installed as an indirect waste in accordance with the requirements of Chapter 8 of the California Plumbing Code.

The backwash from a diatomaceous earth filter shall discharge into a separation tank that has been installed to collect the waste diatomaceous earth mixture. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

#### 36K597 Construction - Pool shell tiles and surface

POINTS <b>1</b>	Compliance Date: Not Specified	Inspector Comments: Observed the finish color on the shell of the pool bright blue.  Ensure that the finish color of the pool is white except for the specified portions of the pool.
	Not In Compliance	
	Violation Reference - CCR - 3108B	

**Violation Description:** The finished pool shell shall be lined with a smooth waterproof interior finish that will withstand repeated brushing, scrubbing and cleaning procedures. The interior pool finish shall completely line the pool to the tile lines, coping, or cantilevered deck.

The finish color shall be white except for the following which shall be of contrasting color:

1. Lane and other required pool markings described in Section 3110B of the California Code of Regulations; and
2. The top surface edges of benches in spa pools; and
3. The edge of pool steps; and
4. Tiles installed at the waterline; and
5. Tiles installed at the 4 1/2-foot (1372 mm) depth line.

#### 36K596 Permit - Public Pool Closure

POINTS <b>NA</b>	Compliance Date: Not Specified	Inspector Comments: Due to low levels of free chlorine and the electrical hazard of the GFCI the pool is closed.  Please contact the Division of Environmental Health at 1-800-442-2283 when the pool is ready to re-open.
	Not In Compliance	
	Violation Reference - HSC - 65545	

**Description:** A public pool that is maintained or operated in a manner that creates an unhealthful, unsafe, or unsanitary condition may be closed by the enforcing agent. Unhealthful, unsafe, or unsanitary conditions include, but are not limited to, failure to maintain clean pool water and clear pool water requirements; inadequate disinfection; improper pH; the presence of inhalation hazards; failure to meet microbiological or chemical water-quality standards; missing or broken suction outlet covers; missing or broken pool enclosures, including fencing and gates; hazards to pool users; and any other violation of these regulations identified by the enforcing agent. A public pool shall not be reopened until the unhealthful, unsafe, or unsanitary condition has been rectified and upon specific written approval from the enforcing agent.

#### Overall Inspection Comments

No summary comments have been made for this inspection.



**Public Health**  
**Environmental Health Services**

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME TREE TOP LODGE	DATE 8/25/2015
LOCATION 27992 RAINBOW DR, LAKE ARROWHEAD, CA 92352	INSPECTOR Yvette Velasco

**Signature(s) of Acknowledgement**

NAME:

TITLE:

Total # of Images: 0