



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME BEST WESTERN ONTARIO AIRPORT		DATE 5/21/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 1/31/2016
LOCATION 209 N VINEYARD AV, ONTARIO, CA 91764			INSPECTOR John Ramos	
MAILING ADDRESS 209 N VINEYARD AV, ONTARIO CA 91764			IDENTIFIER: Spa	
			SERVICE: 001 - INSPECTION - ROUTINE	
TIME IN 2:26 PM	TIME OUT 3:25 PM	FACILITY ID FA0008456	RELATED ID PR0014532	PE 3623
			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
			ACTION: 01 - NO FURTHER ACTION REQUIRED	




RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

93
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

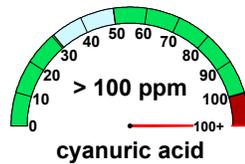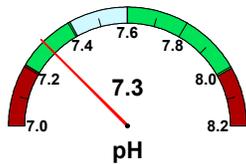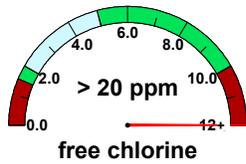

temperature (°F)	104.0
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

IMPORTANT: Replacement of Suction Outlet Covers
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:
1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump
Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K502 Water Quality - Critical – Disinfectant level ⚠ CRITICAL ⚠

POINTS 5	Comply by: 5/23/2015	Inspector Comments: Observed chlorine at 50 ppm (used chlorine test strips to verify). Maintain chlorine between 1.0 and 10.0. Corrected to 9.96 ppm
	Complied on 5/21/2015	
	Violation Reference - HSC - 65529	

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm2 by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm2 the operator shall close the spray ground and water features.

36K518 Water Quality – Cyanuric acid concentration

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed Cyanuric Acid above 100 ppm. Maintain a Cyanuric Acid level at or below 100 ppm.
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Comply by: 6/4/2015	Inspector Comments: Observed stuck flow meter. Repair or replace flow meter.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

Overall Inspection Comments



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME BEST WESTERN ONTARIO AIRPORT	DATE 5/21/2015
LOCATION 209 N VINEYARD AV, ONTARIO, CA 91764	INSPECTOR John Ramos

Correct the above noted violations.

Facility uses one GFCI per pool/spa light fixture.

If you have any questions contact John Ramos at (800) 442-2283 or at John.Ramos@dph.sbcounty.gov

Signature(s) of Acknowledgement

NAME:
TITLE:

Total # of Images: 0