



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME BEST WESTERN HOSPITALITY					DATE 9/27/2012	SIGNATURE <i>[Signature]</i>	
LOCATION 294 E HOSPITALITY LN, SAN BERNARDINO, CA 92408					REINSPECTION DATE 10/11/2012	PERMIT EXPIRATION 11/30/2012	
MAILING ADDRESS 294 E HOSPITALITY LN, SAN BERNARDINO, CA 92408					REHS Marilyn Krichbaum		
FA # FA0004432	PR # PR0013714	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Spa		
TIME IN 9:45 AM	TIME OUT 10:20 AM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 05 - Corrective Action / Follow up Required		
					ACTION: 03 - Reinspection Required		




RECREATIONAL HEALTH - PUBLIC POOL/SPA

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50

Recreational Health Details

Ideal
In Compliance
Not in Compliance

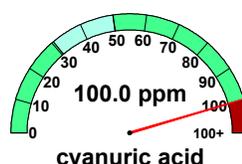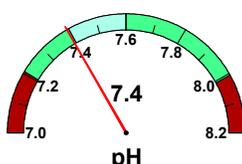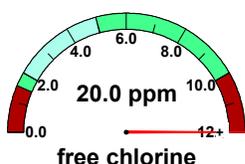

temperature (F)	103.0
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	4

Inspection Violations

Critical Violations

1. Equipment - Chlorinator/Disinfectant Feeder

Compliance Date not Specified
Not In Compliance
Violation Reference: CCR - 3123B, 3133B, 65529

Violation Description: Pools, when open for use, are required to be disinfected continuously by a chemical which imparts a residual effect. Each pool shall be provided with a separate treatment system designed for continuous disinfection of the pool water. The disinfectant feeder shall be capable of supplying not less than the equivalent of 3 pounds of chlorine per day per 10,000 gallons of pool water capacity.

Inspector Comments: Observed that the chlorinator could not be opened. Observed chemical buildup on chlorinator. Employee could not open it. Clean out and repair chlorinator or replace it.

2. Water Quality - Chlorine - high

Compliance Date not Specified
Not In Compliance
Violation Reference: CCR

Violation Description: Free chlorine shall not exceed 10 ppm when pool is open for use.

Inspector Comments: Observed a very high chlorine greater than 10ppm approaching 200ppm. Employee is in the process of draining the water in the spa. Spa can be conditionally reopened once the chlorine is less than 10ppm.

3. AB 1020 - Open for Use - Not in Compliance

Compliance Date not Specified
Not In Compliance
Violation Reference: CCR

Violation Description: Pool or spa is in violation of State Assembly Bill 1020, the Anti- Entrapment Devices and System Law for Public Swimming Pools. The compliance date of July 1, 2010 has passed. Pool/spa observed accessible for use in violation of previous closure notices issued by EHS. Health Permit is suspended, and the pool/spa is posted closed at this time. Immediately close and secure pool/spa for use. Pool/spa may not reopen until the AB 1020 form has been reviewed and approved by EHS. Failure to comply will result in charged reinspections and legal action until such time compliance is achieved. Reinspections will be billed at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Inspector Comments: Observed no AB 1020 device on the spa recirculatory system pump. Observed vacless devices on the other pumps. Have the pool company call me. Immediately reinstall the AB 1020 device on the spa recirculatory pump otherwise spa will be closed by 10-11-12.

Non-critical Violations

4. Maintenance - Record Keeping

Compliance Date not Specified
Not In Compliance
Violation Reference: CCR - 65523(a)

Violation Description: The operator of each pool open for use shall keep an accurate daily record of information regarding operation, including readings of disinfectant residual, pH, and maintenance procedures such as cleaning of filters and quantity of chemicals used. If cyanuric acid is used it shall be measured a minimum of once per month. Data shall be maintained at least a year for inspection by DEHS.

Inspector Comments:

CONTINUES...

[EHS would appreciate your feedback on this inspection. Click here to take our survey or browse to \[surveymonkey.com/s/rehealthsurvey\]\(http://surveymonkey.com/s/rehealthsurvey\)](#)



County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME BEST WESTERN HOSPITALITY	DATE 9/27/2012	SIGNATURE 
LOCATION 294 E HOSPITALITY LN, SAN BERNARDINO, CA 92408	REHS Marilyn Krichbaum	

Inspection Violations (Continued)

Non-critical Violations

5. Maintenance - Record Keeping

Compliance Date not Specified

Not In Compliance

Violation Reference: CCR -
65523(a)

Violation Description: The operator of each pool open for use shall keep an accurate daily record of information regarding operation, including readings of disinfectant residual, pH, and maintenance procedures such as cleaning of filters and quantity of chemicals used. If cyanuric acid is used it shall be measured a minimum of once per month. Data shall be maintained at least a year for inspection by DEHS.

Inspector Comments: Observed no daily log of spa chlorine and ph levels. Maintain a daily log of these levels.

6. Skimmers - Weir

Compliance Date not Specified

Not In Compliance

Violation Reference: CCR 24 -
3134

Violation Description: Skimmer(s) shall have a weir which automatically adjusts to variations of the water level less than 4 inches.

Inspector Comments: Replace missing weir gate in skimmer.

Overall Inspection Comments

No summary comments have been made for this inspection.