



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME RED HILL COUNTRY CLUB				DATE 6/17/2013	SIGNATURE
LOCATION 8358 RED HILL COUNTRY CLUB DR, RANCHO CUCAMONGA, CA 91730				REINSPECTION DATE 12/17/2013	PERMIT EXPIRATION 12/31/2013
MAILING ADDRESS 8358 RED HILL COUNTRY CLUB DR, RANCHO CUCAMONGA, CA 91730				REHS Isaac Gebreslassie	
FA # FA0007682	PR # PR0013571	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: pool
TIME IN 11:22 AM	TIME OUT 12:06 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine
					RESULT: 03 - Corrective Action / No Follow up Required
					ACTION: 01 - No Further Action Required




RECREATIONAL HEALTH - PUBLIC POOL/SPA

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

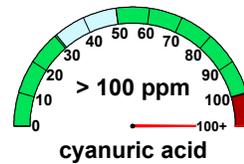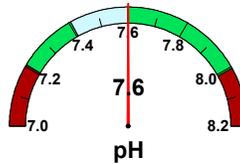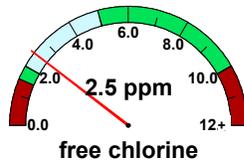

temperature (F)	No Data
observed flow (gpm)	250
required flow (gpm)	No Data
volume (gal)	150,000
area (sq ft)	1,875
occupancy	No Data

36K460 Skimmers - Requirements

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65533, 3136B

Inspector Comments: Observed all skimmers without float assembly. (COS)

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K462 Plumbing - Backflow Protection

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 3141B, 3118B

Inspector Comments: Observed potable water hose bib without any back flow prevention device system being used to fill pool with water. Discontinue practice immediately, and provide a back flow device to fill line.

Violation Description: There shall be no direct connection between any potable water supply system and the pool or its piping system unless protected by a backflow prevention device in accordance with Chapter 6 of the California Plumbing Code. There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system. Potable water outlets with hose attachments shall be protected by a nonremovable hose bibb backflow preventer, a nonremovable hose bibb vacuum breaker, or by an atmospheric vacuum breaker.

36K466 Structure - Pool Shell

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 3108B

Inspector Comments: Observed cracks on pool shell. Re-plaster pool shell to render it waterproof.

Violation Description: The finished pool shell shall be lined with a smooth waterproof interior finish that will withstand repeated brushing, scrubbing, and cleaning procedures. The finish color shall be white. Tiles installed at the waterline shall be of contrasting color. A spa pool may be finished in a light color other than white when approved by the enforcing agent. Pool shell shall be maintained in good repair.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:
No Photo Attachments