



County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME OASIS TOWNHOUSE APARTMENTS					DATE 7/19/2013	SIGNATURE	
LOCATION 25590 PROSPECT AV, LOMA LINDA, CA 92354					REINSPECTION DATE 8/02/2013	PERMIT EXPIRATION 10/31/2013	
MAILING ADDRESS 25590 PROSPECT AV, LOMA LINDA, CA 92354					REHS Yong Aday		
FA # FA0004118	PR # PR0015356	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: office spa		
TIME IN 3:43 PM	TIME OUT 4:10 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 05 - Corrective Action / Follow up Required		
					ACTION: 13 - Permit Suspended / Facility Closed		

RECREATIONAL HEALTH - PUBLIC POOL/SPA




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

90

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

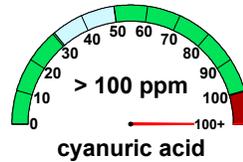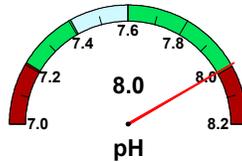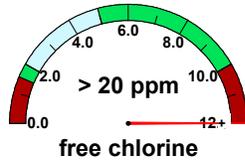

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	77
volume (gal)	2,323
area (sq ft)	109
occupancy	10

36K995 Permit - Suspension

⚠ CRITICAL ⚠

POINTS
NA

Compliance Date: Not Specified
Not In Compliance
Violation Reference - HSC

Inspector Comments: The spa is ordered to be closed due to high chlorine. Call your inspector to reopen when chlorine level is at 1.5-10ppm: Yong Aday at 800-442-2283.

Violation Description: Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

36K404 Water Quality - Critical - High Disinfectant Level

⚠ CRITICAL ⚠

POINTS
4

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: Observed above 20ppm chlorine in the spa.

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K418 Water Quality - Cyanurates

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: Observed cyanuric acid level at above 100ppm in the spa.

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

36K448 Equipment - Flow Meter

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 3125B

Inspector Comments: Observed non-functioning flow meter.

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
 RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME OASIS TOWNHOUSE APARTMENTS	DATE 7/19/2013	SIGNATURE
LOCATION 25590 PROSPECT AV, LOMA LINDA, CA 92354	REHS Yong Aday	

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed water level too high for proper skimming in the spa.
	Not In Compliance	
Violation Reference - CCR - 65533, 3136B		

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments