



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME HILTON GARDEN INN SAN BERNARDINO					DATE 7/24/2013	SIGNATURE	
LOCATION 1755 S WATERMAN AV, SAN BERNARDINO, CA 92408					REINSPECTION DATE 1/24/2014	PERMIT EXPIRATION 7/31/2013	
MAILING ADDRESS 42 CORPORATE PARK STE 200, IRVINE CA 92606					REHS Yong Aday		
FA # FA0018426	PR # PR0024474	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: SPA		
TIME IN 10:21 AM	TIME OUT 10:42 AM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 03 - Corrective Action / No Follow up Required		
					ACTION: 01 - No Further Action Required		




RECREATIONAL HEALTH - PUBLIC POOL/SPA

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

92
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

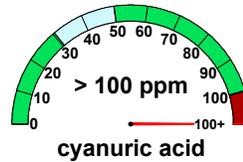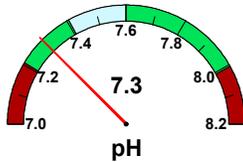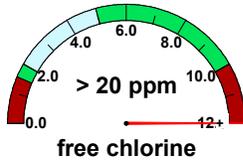

temperature (F)	103.0
observed flow (gpm)	50
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

36K404 Water Quality - Critical - High Disinfectant Level



POINTS
4

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: Chlorine level tested at above 20ppm in the spa. Operator started to drain some water and refill with fresh water. Ensure chlorine level at 1.5-10ppm prior to being used.

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K418 Water Quality - Cyanurates

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: Observed cyanuric acid level at above 100ppm in the spa.

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

36K460 Skimmers - Requirements

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65533, 3136B

Inspector Comments: Replace missing weir gate for the skimmer.

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:
No Photo Attachments