



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME SUPER 8 MOTEL					DATE 8/22/2013	SIGNATURE	
LOCATION 170 COOLWATER LN, BARSTOW, CA 92311					REINSPECTION DATE 2/22/2014	PERMIT EXPIRATION 2/28/2014	
MAILING ADDRESS 170 COOLWATER LN, BARSTOW CA 92311					REHS Kathy Taylor		
FA # FA0006125	PR # PR0014888	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Pool		
TIME IN 9:30 AM	TIME OUT 10:10 AM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 03 - Corrective Action / No Follow up Required		
					ACTION: 01 - No Further Action Required		

RECREATIONAL HEALTH - PUBLIC POOL/SPA



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

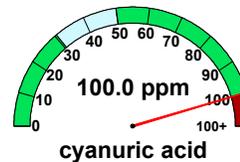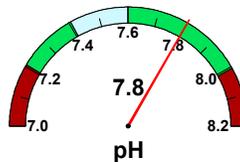

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	50
volume (gal)	18,200
area (sq ft)	600
occupancy	30

36K418 Water Quality - Cyanurates

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: Cyanuric acid level slightly above 100 ppm; drain a little water out of pool and add fresh. Retest to ensure level is below 100 ppm.

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

36K448 Equipment - Flow Meter

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 3125B

Inspector Comments: Repair stuck flowmeter. The float needs to be dislodge and ensure it is operable. Ensure a flow of or about 50 gpm is attained for this pool.

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K460 Skimmers - Requirements

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65533, 3136B

Inspector Comments: Clean skimmers and ensure all parts are present. Unable to remove skimmer basket due to heavy accumulation of pine needles. Clean out both skimmers.

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

Overall Inspection Comments

New sign requirements go into effect next pool season - flyer left today.

Ensure Missing Certified Food Worker Card sheet is filled out and faxed to San Bernardino within 2 weeks of today's date.

Thank you

Photo Attachments:
No Photo Attachments