



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME CELAMONTE		DATE 6/3/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 6/30/2015
LOCATION 17871 SHADY VIEW DR, CHINO HILLS, CA 91709			INSPECTOR Casey Salazar	
MAILING ADDRESS 25531 COMMERCENTER DR STE 100, LAKE FOREST CA 92630			IDENTIFIER: Spa	
TIME IN 11:00 AM			SERVICE: 001 - INSPECTION - ROUTINE	
TIME OUT 12:07 PM			RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQ	
FACILITY ID FA0015564		RELATED ID PR0020693	ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED	
PE 3623				

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

87

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

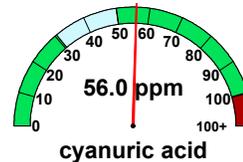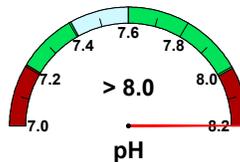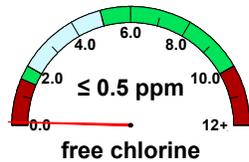

temperature (°F)	103.4
observed flow (gpm)	55
required flow (gpm)	51
volume (gal)	1,521
area (sq ft)	78
occupancy	8

IMPORTANT: Replacement of Suction Outlet Covers

Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K502 Water Quality - Critical – Disinfectant level



POINTS 5	Compliance Date: Not Specified	Inspector Comments: Observed free chlorine levels at 0.11 ppm. Maintain free chlorine between 2-10 ppm.
	Not In Compliance	
	Violation Reference - HSC - 65529	

Violation Description: The minimum concentration of disinfectant residual in public pools shall be 1.0 ppm free-chlorine without cyanuric acid or 2.0 ppm free-chlorine with cyanuric acid. The minimum concentration of disinfectant residual in public spas, wading pools, and spray grounds shall be 3.0 ppm free-chlorine. The maximum concentration of disinfectant residual shall be 10.0 ppm free-chlorine.

The minimum concentration of bromine residual in public pools shall be 2.0 ppm. The minimum concentration of bromine residual in public spas, wading pools, and spray grounds shall be 4.0 ppm.

A spray ground and water features with an ultraviolet light disinfection system shall be disinfected continuously at a minimum of 40 mJ/cm² by the ultraviolet light disinfection units while the spray ground and water features are in use. If the ultraviolet dosage rate drops below 40 mJ/cm² the operator shall close the spray ground and water features.

36K506 Water Quality - Critical – Water pH 7.2 to 7.8



POINTS 5	Comply by: 6/5/2015	Inspector Comments: Observed pH at 8.1. Lower pH to 7.2-7.8.
	Not In Compliance	
	Violation Reference - HSC - 65530	

Violation Description: The pool operator shall maintain public pool water at pH 7.2 to 7.8.

36K516 Water Quality – Non-Critical – Water clarity

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed cloudy water in spa. Main drains were still visible from deck. Maintain water clear while pool/spa is in use.
	Not In Compliance	
	Violation Reference - HSC - 65527	

Violation Description: The pool operator shall maintain clear pool water while the public pool is in use. The pool operator shall close the public pool if the bottom of the pool at the maximum depth is not clearly visible from the deck. The pool operator shall not reopen the public pool for use until the pool water is clean and clear, and the bottom of the pool at the maximum depth is clearly visible from the deck. If the bottom of the pool is not visible 48 hours following inspection and closure by the enforcing agent, the enforcing agent may order the pool drained.



Public Health
Environmental Health Services

RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME CELAMONTE	DATE 6/3/2015
LOCATION 17871 SHADY VIEW DR, CHINO HILLS, CA 91709	INSPECTOR Casey Salazar

IMPORTANT: Replacement of Suction Outlet Covers
 Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

1. Meet the latest ANSI/APSP-16 performance standard
2. Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

36K556 Equipment – Plumbing labeled

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observed incomplete labeling for spa recirculation equipment. Label to indicate direction of flow
	Not In Compliance	
	Violation Reference - CCR 24 - 3120B	

Violation Description: The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

36K582 Maintenance - Public pool site maintenance

POINTS 1	Compliance Date: Not Specified	Inspector Comments: Observe spa light not operating. Repair/replace spa light.
	Not In Compliance	
	Violation Reference - HSC - 65535	

Violation Description: The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

36K596 Permit - Public Pool Closure

POINTS NA	Compliance Date: Not Specified	Inspector Comments: Permit is suspended and spa is closed due to high pH levels. Do not open without approval from San Bernardino County Environmental Health Services.
	Not In Compliance	
	Violation Reference - HSC - 65545	When ready to open contact 800-442-2283.

Description: A public pool that is maintained or operated in a manner that creates an unhealthful, unsafe, or unsanitary condition may be closed by the enforcing agent. Unhealthful, unsafe, or unsanitary conditions include, but are not limited to, failure to maintain clean pool water and clear pool water requirements; inadequate disinfection; improper pH; the presence of inhalation hazards; failure to meet microbiological or chemical water-quality standards; missing or broken suction outlet covers; missing or broken pool enclosures, including fencing and gates; hazards to pool users; and any other violation of these regulations identified by the enforcing agent. A public pool shall not be reopened until the unhealthful, unsafe, or unsanitary condition has been rectified and upon specific written approval from the enforcing agent.

Overall Inspection Comments

Permit is suspended and spa is closed due to high pH levels. Do not open without approval from San Bernardino County Environmental Health Services.

When ready to open contact 800-442-2283.

Signature(s) of Acknowledgement

SNA

NAME:
TITLE:

Total # of Images: 0