



**Public Health**  
Environmental Health Services

**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

FACILITY NAME MT VIEW PARK CONDOS		DATE 5/7/2015	REINSPECTION DATE Not Specified	PERMIT EXPIRATION 6/30/2015
LOCATION 149 W 6TH ST, SAN BERNARDINO, CA 92401			INSPECTOR Chris Nwadike	
MAILING ADDRESS PO BOX 200, MENTONE CA 92359			IDENTIFIER: Pool	
TIME IN 9:36 AM			SERVICE: 001 - INSPECTION - ROUTINE	
TIME OUT 10:44 AM			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP RE	
FACILITY ID FA0008859			ACTION: 01 - NO FURTHER ACTION REQUIRED	
RELATED ID PR0014213			PE 3620	




**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**97**  
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

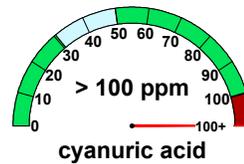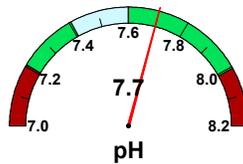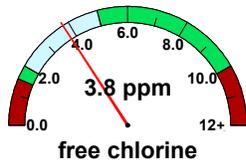

temperature (°F)	72.0
observed flow (gpm)	70
required flow (gpm)	No Data
volume (gal)	18,000
area (sq ft)	512
occupancy	25

**IMPORTANT: Replacement of Suction Outlet Covers**  
Suction Outlet covers (anti-entrapment covers over main drains and skimmer equalizer outlets) shall be replaced upon expiration. The expiration (in years) is stamped on the front of each cover, indicating the amount of time the cover is valid after installation. Each replacement cover shall:

- Meet the latest ANSI/APSP-16 performance standard
- Be rated for the maximum designed flow-rate of the pump

Retain all records which indicate the make/model number of the replacement cover and date of installation. Records shall be made available to your inspector upon request.

**36K518 Water Quality – Cyanuric acid concentration**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed the cyanuric acid at more than 109.0ppm. Maintain cyanuric acid level below 100.0ppm (under 50.0ppm preferred). Make the correction before reopening.
	Not In Compliance	
	Violation Reference - HSC - 65530	

**Violation Description:** The maximum concentration of cyanuric acid in public pool water shall not exceed 100.0 ppm.

**36K556 Equipment – Plumbing labeled**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no labels/markings on the piping in the equipment/pump area showing the direction of water flow/recirculation. The direction of water flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.
	Not In Compliance	
	Violation Reference - CCR 24 - 3120B	

**Violation Description:** The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area. Where the recirculation equipment for more than one pool is located on site, the equipment shall be marked as to which pool the system serves. Valves and plumbing lines shall be labeled clearly with the source or destination descriptions.

**36K582 Maintenance - Public pool site maintenance**

<b>POINTS</b> <b>1</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed heavy trash build up in the pump room. Provide immediate cleaning to the pump room
	Not In Compliance	
	Violation Reference - HSC - 65535	

**Violation Description:** The pool operator shall keep all parts of the public pool site well-maintained, including, but not limited to, the public pools, water treatment systems, ancillary facilities, signs, showers, toilets, dressing facilities, drinking fountains, diaper-changing stations, floors, walls, partitions, doors, and lockers.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Signature(s) of Acknowledgement**



## Public Health

### Environmental Health Services

#### RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

FACILITY NAME MT VIEW PARK CONDOS	DATE 5/7/2015
LOCATION 149 W 6TH ST, SAN BERNARDINO, CA 92401	INSPECTOR Chris Nwadike

NAME:

TITLE:

Total # of Images: 0