



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME REDLANDS EAST VALLEY HIGH SCHOOL					DATE 3/26/2013	SIGNATURE	
LOCATION 3100 E COLTON AV, MENTONE, CA 92374					REINSPECTION DATE 4/09/2013	PERMIT EXPIRATION	
MAILING ADDRESS 3100 E COLTON AV, MENTONE, CA 92374					<input checked="" type="checkbox"/> FACILITY <input type="checkbox"/> OWNER <input type="checkbox"/> ACCOUNT REHS Antonio Fields		
FA # FA0000782	PR # PR0015855	SR # Not Specified	CO # Not Specified	PE 3603	PROGRAM IDENTIFIER: pool		
TIME IN 2:04 PM	TIME OUT 3:23 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 05 - Corrective Action / Follow up Required		
					ACTION: 03 - Reinspection Required		


RECREATIONAL HEALTH - PUBLIC SCHOOL POOL / SPA

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50

Recreational Health Details

Ideal
In Compliance
Not in Compliance

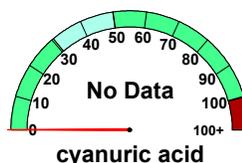

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	833
volume (gal)	300,000
area (sq ft)	No Data
occupancy	No Data

Inspection Violations

Non-critical Violations

1. Maintenance - Record Keeping

Compliance Date not Specified
Not In Compliance
Violation Reference: CCR - 65523(a)

Violation Description: The operator of each pool open for use shall keep an accurate daily record of information regarding operation, including readings of disinfectant residual, pH, and maintenance procedures such as cleaning of filters and quantity of chemicals used. If cyanuric acid is used it shall be measured a minimum of once per month. Data shall be maintained at least a year for inspection by DEHS.

Inspector Comments: No daily records observed. Maintain daily record of pool maintenance on-site.

2. Safety - Safety Signs

Compliance Date not Specified
Not In Compliance
Violation Reference: CCR 24 - 3119B

Violation Description: Safety signs are required to be conspicuously posted and maintained as to be legible: "Warning, No Lifeguard On Duty", "Occupant Load", diagrammatic illustrations of artificial respiration procedures, emergency telephone numbers (ambulance, fire, and police or sheriff's department), warning sign for spa containing "Caution" language, "Emergency Shut-off Switch" for spa. "No Diving Allowed" for shallow pools, "Danger: Gaseous Oxidizer Chlorine" for gas chlorinators, "No Use Of Pool Allowed After Dark" for pools without a light fixture.

Inspector Comments: Sign for emergency number and artificial respiration procedures observed missing. Provide essential safety signs around the pool area.

3. Decking - Requirement

Compliance Date not Specified
Not In Compliance
Violation Reference: CCR - 3113B

Violation Description: The deck shall be a minimum 4 feet wide (clear and unobstructed), slip resistant, non-abrasive, sloped away from the pool and maintained clean and in good repair. (Exception – only 50% around a spa, none for a temporary training pool)

Inspector Comments: Abrasive decking surface observed. Repair/Replace. Ensure the deck is non-abrasive, slip resistant, and maintain in good repair.

4. Structure - Shell Bottom / Sides - Requirement

Compliance Date not Specified
Not In Compliance
Violation Reference: CCR - 3106B, 65533

Violation Description: The pool shell must be white in color; free of any projections; free of designs that might reasonably be mistaken for, or give the illusion of being a human form; clean and well maintained. Pool shell and tile must be properly maintained. Exceptions - Spa shell may have a light pastel color. Benches are permitted in spa pool providing that the water depth over the bench does not exceed 24 inches.

Inspector Comments: Excessive chipping of pool shell and tiles observed in the pool. Repair/Replace.

Large piece of the pool observed damaged near the underwater tile. Repair/Replace.

Heavy rusting observed along the bottom of the pool. Maintain pool in good repair.

Overall Inspection Comments

CONTINUES...



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME REDLANDS EAST VALLEY HIGH SCHOOL	DATE 3/26/2013	SIGNATURE
LOCATION 3100 E COLTON AV, MENTONE, CA 92374		REHS Antonio Fields

The facility has 3 months to make necessary repairs to the pool. Ensure damage decking and tiles within the pool are repair by the deadline. Employee stated students have reported cutting their feet on the broken tiles within the pool. Failure to make the necessary repair may result in the closure of the pool facility or other legal actions. If the pool area cannot be completely repaired within 3 months, contact the County of San Bernardino at 800-442-2283 to provide a bidding of the repairs needed and/or any necessary updates.

Follow-up needed to ensure chemical levels of the pool are within safe concentrations.