



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dehs

FACILITY NAME DESERT HEIGHTS APARTMENTS					DATE 5/16/2013	SIGNATURE	
LOCATION 1801 E RIMROCK RD, BARSTOW, CA 92311					REINSPECTION DATE 11/16/2013	PERMIT EXPIRATION 11/30/2013	
MAILING ADDRESS 1667 E LINCOLN AV, ORANGE CA 92865					REHS Kathy Taylor		
FA # FA0004691	PR # PR0015246	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Wading Pool		
TIME IN 10:50 AM	TIME OUT 11:15 AM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 03 - Corrective Action / No Follow up Required		
					ACTION: 01 - No Further Action Required		

RECREATIONAL HEALTH - PUBLIC POOL/SPA



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

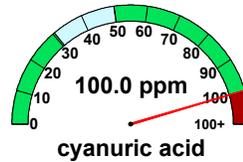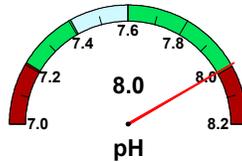

temperature (F)	65.0
observed flow (gpm)	0
required flow (gpm)	19
volume (gal)	1,122
area (sq ft)	122
occupancy	6

36K418 Water Quality - Cyanurates

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Lower cyanuric acid level by draining a little water out and adding fresh; cyanuric acid level found in excess of 100 ppm.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Unable to see flowmeter but there appears to be a strong return rate of water. Please check. Minimum turnover rate for this pool is only 19 gpm.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K456 Maintenance - Spa/Pool Area - Pump Room

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Clean/organize pump room to remove all debris, trash, etc. to make all pool equipment easily accessible.
	Not In Compliance	
	Violation Reference - CCR - 65535	

Violation Description: All parts of the pool and related pool facilities and equipment shall be maintained in good repair. Floors shall be kept free from cracks and other defects. Walls, ceilings, partitions, doors and similar surfaces and equipment shall be refinished in a manner acceptable to DEHS as often as necessary to be kept in a state of good repair. Hoses shall be provided for regular flushing and cleaning. The whole pool area shall be kept clean, sanitary and free of litter and vermin.

Overall Inspection Comments

See pool report for signage and directional arrows requirement for next year.

One main drain appears to have more debris build-up; please check and ensure suction is split equally between main drains.

pH at upper legal limit; please lower to the 7.4-7.6 range. At this point, it is almost too alkaline for bather safety.

Thank you

Photo Attachments:
No Photo Attachments