



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME CANOGA STREET APARTMENTS				DATE 6/6/2013	SIGNATURE
LOCATION 4841 CANOGA ST, MONTCLAIR, CA 91763				REINSPECTION DATE 6/20/2013	PERMIT EXPIRATION 4/30/2014
MAILING ADDRESS PO BOX 280-421, NORTHRIDGE CA 91328				REHS Jose Rodriguez	
FA # FA0008471	PR # PR0015896	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Pool SERVICE: 001 - Inspection - Routine
TIME IN 2:55 PM	TIME OUT 3:30 PM	CONTACT Not Captured			RESULT: 05 - Corrective Action / Follow up Required ACTION: 13 - Permit Suspended / Facility Closed




RECREATIONAL HEALTH - PUBLIC POOL/SPA

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

90
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

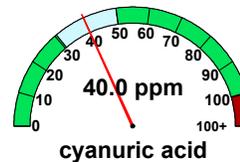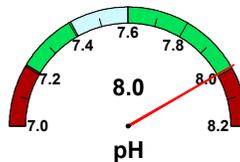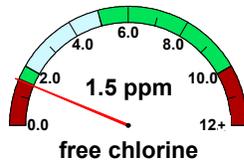

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

36K995 Permit - Suspension

⚠ CRITICAL ⚠

POINTS
NA

Compliance Date: **Not Specified**
Not In Compliance
Violation Reference - **HSC**

Inspector Comments: Pool has been closed due to loose main drain cover and enclosure issues. Contact health dept. (800) 442-2283.

Failure to correct issues will result in further re-inspections charged at \$122.50 per 30 minutes.

Violation Description: Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

36K436 Enclosure - Critical - Enclosure Drowning Hazard

⚠ CRITICAL ⚠

POINTS
4

Compliance Date: **Not Specified**
Not In Compliance
Violation Reference - **CCR 24 - 3119B**

Inspector Comments: Observed several bars that need to be welded on the fence. Observed loose, corroded and in disrepair. Correct fence immediately.

Violation Description: The pool shall be enclosed by one or a combination of the following: a fence; portion of a building; wall; or other approved durable enclosure. Doors, windows gates of living units or associated private premises shall not be permitted as part of the pool enclosure. The enclosure shall have a minimum effective perpendicular height of 5 feet. Openings, holes or gaps in the enclosure, doors and/or gates shall not allow the passage of a 4-inch diameter sphere. The enclosure shall be constructed over a hard and permanent material equivalent to concrete. The enclosure shall be designed and constructed so that it cannot be readily climbed by small children.

36K488 AB 1020 - Critical - Non-Compliant Pool/Spa

⚠ CRITICAL ⚠

POINTS
NA

Compliance Date: **Not Specified**
Not In Compliance
Violation Reference - **CCR**

Inspector Comments: Observed main drain cover loose and main drain exposed. Ensure that cover is installed properly and tightly.

Violation Description: Pool or spa is in violation of State Assembly Bill 1020, the Anti-Entrapment Devices and System Law for Public Swimming Pools. The compliance date of July 1, 2010 has passed. Compliance with AB 1020 is required. Health Permit is suspended, and the pool/spa is posted closed at this time. A drained pool/spa shall remain closed and secured until plans have been submitted to and approved by DEHS and all related construction finalized. Pool/spa shall meet all current health code requirements including compliance with AB 1020. If pool/spa is to be demolished, approval from Building and Safety must be obtained. Submit copy of finalized building permit to EHS for permit inactivation.

36K448 Equipment - Flow Meter

POINTS
2

Compliance Date: **Not Specified**
Not In Compliance
Violation Reference - **CCR - 3125B**

Inspector Comments: Observed stuck flow meter. Repair/replace to be accurate within 10% of the flow.

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME CANOGA STREET APARTMENTS		DATE 6/6/2013	SIGNATURE
LOCATION 4841 CANOGA ST, MONTCLAIR, CA 91763		REHS Jose Rodriguez	

36K454 Maintenance - Cleanliness

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Clean/maintain pool bottom. Observed dirty.
	Not In Compliance	
	Violation Reference - CCR - 65533	

Violation Description: Floating scum, sputum or debris shall not be allowed to accumulate in the pool. The bottom and sides of the pool shall be cleaned as often as necessary to be kept in a clean condition. The sides and bottom of pools, decks and other surfaces shall be kept free of slime and algae.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed missing weir gate.
	Not In Compliance	
	Violation Reference - CCR - 65533, 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments