



County of San Bernardino • Department of Public Health  
 Division of Environmental Health Services  
**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM**  
**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dehs](http://www.sbcounty.gov/dehs)

(800) 442-2283

FACILITY NAME <b>MOUNTAIN VIEW VILLAS</b>				DATE <b>6/10/2013</b>	SIGNATURE <i>See Spa Report</i>
LOCATION <b>21621 SANDIA RD, APPLE VALLEY, CA 92307</b>				REINSPECTION DATE <b>12/10/2013</b>	PERMIT EXPIRATION <b>2/28/2014</b>
MAILING ADDRESS <b>21621 SANDIA RD, APPLE VALLEY, CA 92307</b>				REHS <b>Dawn LaFlower</b>	
FA # <b>FA0004732</b>	PR # <b>PR0016259</b>	SR # <b>Not Specified</b>	CO # <b>Not Specified</b>	PE <b>3601</b>	PROGRAM IDENTIFIER: spa
TIME IN <b>11:13 AM</b>	TIME OUT <b>12:05 PM</b>	CONTACT <b>Not Captured</b>			SERVICE: 001 - Inspection - Routine
					RESULT: 03 - Corrective Action / No Follow up Required
					ACTION: 01 - No Further Action Required


**RECREATIONAL HEALTH - PUBLIC POOL/SPA**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**86**  
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

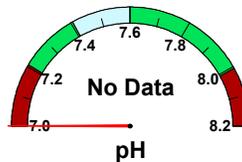

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	65
volume (gal)	23,600
area (sq ft)	1,000
occupancy	50

**36K402 Water Quality - Critical - Lack of Disinfectant**

⚠️ **CRITICAL** ⚠️

<b>POINTS</b> <b>4</b>	Compliance Date: Not Specified	Inspector Comments: Maintain free chlorine between 1.0 and 10.0 ppm when pool is available for use.
	Not In Compliance	Observed free chlorine measuring 0.5 ppm.
	Violation Reference - CCR - 65529	

**Violation Description:** For pools using hypochlorite or gaseous chlorine without a stabilizer, a free chlorine residual at least 1.0 ppm shall be maintained throughout the pool. If cyanuric acid or a chlorinated isocyanurate is used, a free chlorine residual of at least 1.5 ppm shall be maintained throughout the pool.

**36K406 Water Quality - Critical - pH High/Low**

⚠️ **CRITICAL** ⚠️

<b>POINTS</b> <b>4</b>	Compliance Date: Not Specified	Inspector Comments: Maintain pH between 7.2-8.0.
	Not In Compliance	Observed measuring 7.0.
	Violation Reference - CCR - 65529	

**Violation Description:** Water shall be maintained in an alkaline condition at a pH between 7.2 and 8.0.

**36K444 Equipment - Recirculation Pump/Filter/Separation Tank**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	Inspector Comments: Provide a direction of flow on recirculation pipes.
	Not In Compliance	Observed no direction of flow marked on recirculation pipes.
	Violation Reference - HSC - 3120B, 3132B, 3141B	

**Violation Description:** Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM  
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dehs](http://www.sbcounty.gov/dehs)

(800) 442-2283

FACILITY NAME <b>MOUNTAIN VIEW VILLAS</b>	DATE <b>6/10/2013</b>	SIGNATURE <i>See Spa reports</i>
LOCATION <b>21621 SANDIA RD, APPLE VALLEY, CA 92307</b>	REHS <b>Dawn LaFlower</b>	

**36K452 Maintenance - Turnover Time**

<b>POINTS</b> <b>2</b>	Compliance Date: <b>Not Specified</b>	Inspector Comments: <b>Ensure a flow rate of 65 gpm.</b>
	Not In Compliance	<u>Observed flow rate of pool of 125 gpm.</u>
	Violation Reference - <b>CCR 24 - 3124B</b>	

**Violation Description:** The recirculation system shall have the capacity to provide a complete turnover of pool water in:

1. One-half hour or less for a spa pool;
2. One-half hour or less for a spray ground;
3. One hour or less for a wading pool;
4. Two hours or less for a medical pool; and
5. Six hours or less for all other types of public pools.

**36K460 Skimmers - Requirements**

<b>POINTS</b> <b>2</b>	Compliance Date: <b>Not Specified</b>	Inspector Comments: <b>Discontinue placing chlorine tablets in skimmer. Chlorine table are to be used in automatic chlorinator only. Immediately removed chlorine tablets from skimmer to eliminate hazard to swimmers.</b>
	Not In Compliance	<u>Observed numerous chlorine tablets placed in both skimmer baskets.</u>
	Violation Reference - <b>CCR - 65533, 3136B</b>	

**Violation Description:** The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

**36K429 Safety - Notification - New Sign Requirements**

<b>POINTS</b> <b>NA</b>	Compliance Date: <b>Not Specified</b>	Inspector Comments:
	Not In Compliance	
	Violation Reference - <b>CCR 24 - 3120B</b>	

**Violation Description:** Effective September 2012, sign requirements changed. This is not a violation at this time but shall be corrected prior to the 2014 pool season. Failure to comply may result in a violation. The new sign requirements are as follows:

All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- a) Maximum number of pool users permitted for each pool.
- b) "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- c) Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- d) An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- e) The emergency telephone number 911, the number of the nearest emergency services and the name and street address of the pool facility.
- f) A warning sign for spa pools with "CAUTION" language.
- g) Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- h) A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP CLOSED."
- i) A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- j) A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- k) A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Photo Attachments:**

No Photo Attachments