



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME PALM VILLAGE GARDEN HOA					DATE 6/14/2013	SIGNATURE	
LOCATION 1358 SAN DIEGO , ONTARIO, CA 91761					REINSPECTION DATE 6/21/2013	PERMIT EXPIRATION 6/30/2013	
MAILING ADDRESS 525 NEW JERSEY ST STE H, REDLANDS CA 92373					REHS Anies Kondoker		
FA # FA0008582	PR # PR0014052	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: None		
TIME IN 9:19 AM	TIME OUT 9:55 AM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 05 - Corrective Action / Follow up Required		
					ACTION: 03 - Reinspection Required		

RECREATIONAL HEALTH - PUBLIC POOL/SPA




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

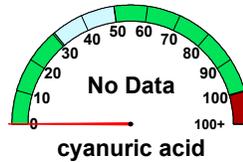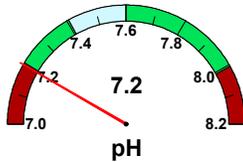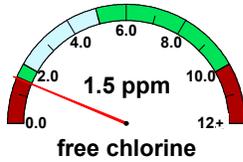

temperature (F)	No Data
observed flow (gpm)	50
required flow (gpm)	125
volume (gal)	45,126
area (sq ft)	989
occupancy	49

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS
2

Compliance Date: Not Specified
 Not In Compliance
 Violation Reference - HSC - 3120B,
 3132B, 3141B

Inspector Comments: Provide a sight glass to the line between filter and separation tank.

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

36K476 Decking - Requirements

POINTS
2

Compliance Date: Not Specified
 Not In Compliance
 Violation Reference - CCR - 3114B

Inspector Comments: Replace missing no diving tile on east decking.

Violation Description: A minimum continuous and unobstructed 4-foot wide slip resistant, cleanable, nonabrasive deck area of concrete or like material shall be provided flush with the top of the pool coping extending completely around the pool, and the deck area shall further extend 4 feet both sides and rear of any diving board, fixed disabled access assistance device or slide and their appurtenances. Deck shall be maintained in good repair.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dehs

(800) 442-2283

FACILITY NAME PALM VILLAGE GARDEN HOA	DATE 6/14/2013	SIGNATURE
LOCATION 1358 SAN DIEGO, ONTARIO, CA 91761	REHS Anies Kondoker	

36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed inoperable shower. Observed missing shower head and handle. Observed standing brownish waste water in handwash sink in men restroom. Observed inoperable toilet in men restroom. Observed non-functioning light and exhaust fan in men restroom. Observed inaccessible women restroom. Replace missing drinking fountain.
	Not In Compliance	
	Violation Reference - CCR - 65535, 65551, 3117B	
REPAIR RESTROOMS AND SHOWERS WITHIN 1 WEEK TO AVOID CHARGED INSPECTIONS.		

Violation Description: Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.

Overall Inspection Comments

PROVIDE POOL AND PUMP ROOM KEY FOR THE INSPECTOR.
Send the key to EHS County of San Bernardino, 8575 N Haven Ave #130 Rancho Cucamonga.
Inspector was able to conduct an inspection with the help of a pool man.

Photo Attachments:
No Photo Attachments