



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME AVENTERRA II APARTMENTS					DATE 7/16/2013	SIGNATURE	
LOCATION 16225 ARROW BL, FONTANA, CA 92335					REINSPECTION DATE 1/16/2014	PERMIT EXPIRATION 5/31/2013	
MAILING ADDRESS 16225 ARROW BL, FONTANA, CA 92335					REHS Chris Nwadike		
FA # FA0005410	PR # PR0015970	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: pool		
TIME IN 4:16 PM	TIME OUT 4:50 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 03 - Corrective Action / No Follow up Required		
					ACTION: 01 - No Further Action Required		



RECREATIONAL HEALTH - PUBLIC POOL/SPA

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

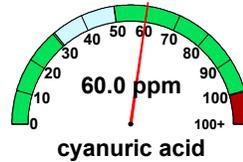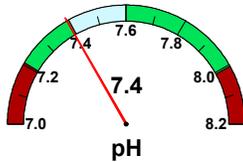

temperature (F)	86.0
observed flow (gpm)	0
required flow (gpm)	107
volume (gal)	38,682
area (sq ft)	1,228
occupancy	35

36K428 Safety - Safety Signs

POINTS 2	Compliance Date: Not Specified
	Not In Compliance
	Violation Reference - CCR 24 - 3120B

Inspector Comments: The occupancy load of the pool was not posted. Post the number.

Violation Description: All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- a) Maximum number of pool users permitted for each pool.
- b) "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- c) Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- d) An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- e) The emergency telephone number 911, the number of the nearest emergency services and the name and street address of the pool facility.
- f) A warning sign for spa pools with "CAUTION" language.
- g) Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- h) A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP CLOSED."
- i) A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- j) A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- k) A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified
	Not In Compliance
	Violation Reference - CCR - 3125B

Inspector Comments: Observed non functioning flow meter. Repair or replace.

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K450 Equipment - Gauges

POINTS 2	Compliance Date: Not Specified
	Not In Compliance
	Violation Reference - CCR - 3125B

Inspector Comments: Observed non functioning influent and effluent gauges. Repair or replace.

Violation Description: A pressure and vacuum gauge shall be provided for each pump system and shall be accurate within 2 percent of scale.

Overall Inspection Comments



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME AVENTERRA II APARTMENTS	DATE 7/16/2013	SIGNATURE
LOCATION 16225 ARROW BL, FONTANA, CA 92335		REHS Chris Nwadike

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments