



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME MOUNTAIN SPRINGS					DATE 7/17/2013	SIGNATURE	
LOCATION 1413 SAN BERNARDINO RD, UPLAND, CA 91786					REINSPECTION DATE 1/17/2014	PERMIT EXPIRATION 6/30/2014	
MAILING ADDRESS 1413 SAN BERNARDINO RD, UPLAND, CA 91786					REHS Shannon Johnson		
FA # FA0006123	PR # PR0014891	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: office pool		
TIME IN 1:12 PM	TIME OUT 1:45 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine		
					RESULT: 03 - Corrective Action / No Follow up Required		
					ACTION: 01 - No Further Action Required		

RECREATIONAL HEALTH - PUBLIC POOL/SPA


Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

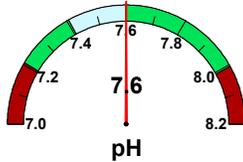

temperature (F)	No Data
observed flow (gpm)	55
required flow (gpm)	75
volume (gal)	27,100
area (sq ft)	905
occupancy	45

36K990 Survey Inspection

POINTS
NA

Compliance Date: Not Specified
Not In Compliance
Violation Reference - SBCC - SBC Policy

Inspector Comments: Correct the following violations.

Violation Description: A survey inspection was conducted on this date.

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - HSC - 3120B, 3132B, 3141B

Inspector Comments: Observed no separation tank hooked up to this recirculation system
Observed no directional symbols on piping within the equipment room.

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

36K460 Skimmers - Requirements

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65533, 3136B

Inspector Comments: Observed no float assembly in the skimmer nearest the 5 ft depth marker. Observed no weir gates at either skimmer.

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME MOUNTAIN SPRINGS	DATE 7/17/2013	SIGNATURE
LOCATION 1413 SAN BERNARDINO RD, UPLAND, CA 91786	REHS Shannon Johnson	

36K472 Access - Steps - Handrails - Diving Area

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed handrails to be loose between the 4.5/5 ft depth markers.
	Not In Compliance	
Violation Reference - CCR - 3111B, 3113B		

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

36K429 Safety - Notification - New Sign Requirements

POINTS NA	Compliance Date: Not Specified	Inspector Comments: Update and correct all safety signs as needed.
	Not In Compliance	
Violation Reference - CCR 24 - 3120B		

Violation Description: Effective September 2012, sign requirements changed. This is not a violation at this time but shall be corrected prior to the 2014 pool season. Failure to comply may result in a violation. The new sign requirements are as follows:

All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- a) Maximum number of pool users permitted for each pool.
- b) "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- c) Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- d) An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- e) The emergency telephone number 911, the number of the nearest emergency services and the name and street address of the pool facility.
- f) A warning sign for spa pools with "CAUTION" language.
- g) Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- h) A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP CLOSED."
- i) A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- j) A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- k) A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."

Overall Inspection Comments

When the filter to the re-circulation system is most clean, clearly mark the initial start-up pressure on the influent gauge, in order for this department to view when the system needs to be backwashed.

Photo Attachments:

No Photo Attachments