



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME MULBERRY PLACE				DATE 7/18/2013	SIGNATURE
LOCATION ARROW ROUTE / VINEYARD , RANCHO CUCAMONGA, CA 91730				REINSPECTION DATE 1/18/2014	PERMIT EXPIRATION 8/31/2013
MAILING ADDRESS PO BOX 5022, UPLAND CA 91785				REHS Anies Kondoker	
FA # FA0006099	PR # PR0014903	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: pool
TIME IN 1:34 PM	TIME OUT 2:00 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine
					RESULT: 03 - Corrective Action / No Follow up Required
					ACTION: 01 - No Further Action Required

RECREATIONAL HEALTH - PUBLIC POOL/SPA



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

90

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

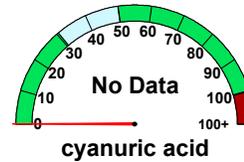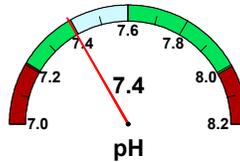

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	45
volume (gal)	22,000
area (sq ft)	740
occupancy	37

36K418 Water Quality - Cyanurates

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Measured cyanuric acid above 100 ppm.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Repair/replace non-functioning flow meter,
	Not In Compliance	
	Violation Reference - CCR - 3125B	

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Provide float assembly to east skimmer.
	Not In Compliance	
	Violation Reference - CCR - 65533, 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K472 Access - Steps - Handrails - Diving Area

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Fasten loose handrail at deep end.
	Not In Compliance	
	Violation Reference - CCR - 3111B, 3113B	

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME MULBERRY PLACE	DATE 7/18/2013	SIGNATURE
LOCATION ARROW ROUTE / VINEYARD , RANCHO CUCAMONGA, CA 91730		REHS Anies Kondoker

36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain

POINTS	Compliance Date: Not Specified	Inspector Comments: Provide soap to the dispenser in women restroom.
2	Not In Compliance	
	Violation Reference - CCR - 65535, 65551, 3117B	

Violation Description: Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments