



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME CASA MEDITERRANIA HOLDING				DATE 7/24/2013	SIGNATURE
LOCATION 1043 SANTO ANTONIO DR, COLTON, CA 92324				REINSPECTION DATE 1/24/2014	PERMIT EXPIRATION 7/31/2013
MAILING ADDRESS 1043 SANTO ANTONIO DR, COLTON CA 92324				REHS John Babalola	
FA # FA0008674	PR # PR0014121	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: pool
TIME IN 3:57 PM	TIME OUT 4:39 PM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine
				RESULT: 03 - Corrective Action / No Follow up Required	
				ACTION: 01 - No Further Action Required	

RECREATIONAL HEALTH - PUBLIC POOL/SPA


Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

86

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

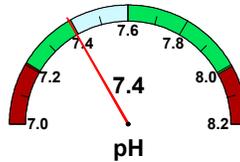

temperature (F)	No Data
observed flow (gpm)	0
required flow (gpm)	60
volume (gal)	No Data
area (sq ft)	No Data
occupancy	40

36K402 Water Quality - Critical - Lack of Disinfectant

⚠ CRITICAL ⚠

POINTS
4

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529

Inspector Comments: The free chlorine level is observed at 0.0 ppm (zero).
Note: Correction is being made.

Violation Description: For pools using hypochlorite or gaseous chlorine without a stabilizer, a free chlorine residual at least 1.0 ppm shall be maintained throughout the pool. If cyanuric acid or a chlorinated isocyanurate is used, a free chlorine residual of at least 1.5 ppm shall be maintained throughout the pool.

36K430 Safety - Equipment/First Aid Kit

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65539

Inspector Comments: No attached rope observed on the life ring.

Violation Description: Every swimming pool shall be equipped for safety and rescue purposes with one or more rescue poles not less than 12 feet in length with body hooks, and one or more life rings having a minimum exterior diameter of 17 inches readily accessible for use. Such life rings shall have attached to them an 3/16 inch line long enough to span the maximum width of the pool. A first aid kit shall be provided at all swimming pools when required by DEHS.

36K446 Equipment - Chlorinator/Heater/Jets

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65529, 65535, 3134B...

Inspector Comments: There is no chlorine tablets inside the automatic chlorinator.

Violation Description: Pools, when open or in use, shall be disinfected continuously by a chemical which imparts a residual effect. Disinfectant feeders shall comply with applicable requirements established by the NSF/ANSI 50-2010 performance standard effective August 2010 for disinfectant feeders. All feeders shall be capable of supplying not less than the equivalent of 3 pounds of 100 percent available chlorine per day per 10,000 gallons of pool water capacity. All parts of the pool and related pool facilities and equipment shall be maintained in good repair. A spa pool aeration and/or jet system shall be completely separate from the recirculation system and shall not be interconnected with any other pool.

36K448 Equipment - Flow Meter

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 3125B

Inspector Comments: Replace/repair the non-functional flow meter.

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME CASA MEDITERRANIA HOLDING	DATE 7/24/2013	SIGNATURE
LOCATION 1043 SANTO ANTONIO DR, COLTON, CA 92324		REHS John Babalola

36K458 Maintenance - Test Kit/Daily Records

POINTS 2	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 65523, 65529	Inspector Comments: No daily records of pH and chlorine observed. <u>Provide a DPD test kit.</u>
-------------------------------	---	--

Violation Description: Appropriate test kits for measuring the pH, concentration of the disinfectant, and, when used, concentration of cyanuric acid shall be provided at each pool. The test kit shall be capable of testing for free chlorine residual.

The operator of each pool open for use shall keep a daily record of information regarding operation, including readings of disinfectant residual, pH and maintenance procedures such as cleaning of filters and quantity of chemicals used.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 65533, 3136B	Inspector Comments: Replace the missing skimmer wier gate.
-------------------------------	---	---

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments