



**County of San Bernardino • Department of Public Health  
Division of Environmental Health Services  
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM  
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

**(800) 442-2283**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

FACILITY NAME <b>CUCAMONGA RIDGE INC</b>					DATE <b>7/25/2013</b>	SIGNATURE	
LOCATION <b>8717 FOOTHILL BL, RANCHO CUCAMONGA, CA 91730</b>					REINSPECTION DATE <b>8/08/2013</b>	PERMIT EXPIRATION <b>5/31/2014</b>	
MAILING ADDRESS <b>8717 FOOTHILL BL, RANCHO CUCAMONGA, CA 91730</b>					REHS <b>Anies Kondoker</b>		
FA # <b>FA0010720</b>	PR # <b>PR0013990</b>	SR # <b>Not Specified</b>	CO # <b>Not Specified</b>	PE <b>3601</b>	PROGRAM IDENTIFIER: spa SERVICE: 001 - Inspection - Routine		
TIME IN <b>1:38 PM</b>	TIME OUT <b>2:08 PM</b>	CONTACT <b>Not Captured</b>			RESULT: 05 - Corrective Action / Follow up Required ACTION: 13 - Permit Suspended / Facility Closed		

**RECREATIONAL HEALTH - PUBLIC POOL/SPA**




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**82**

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

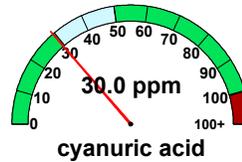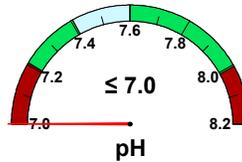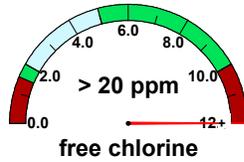

temperature (F)	106.0
observed flow (gpm)	No Data
required flow (gpm)	104
volume (gal)	3,108
area (sq ft)	107
occupancy	10

**36K995 Permit - Suspension**

**⚠ CRITICAL ⚠**

**POINTS**  
**NA**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - HSC

Inspector Comments: Spa permit is suspended due unsafe chlorine level and water temperature.

**Violation Description:** Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

**36K404 Water Quality - Critical - High Disinfectant Level**

**⚠ CRITICAL ⚠**

**POINTS**  
**4**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR - 65529

Inspector Comments: Measured free chlorine at 27 ppm.

**Violation Description:** Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

**36K420 Temperature - Critical - Spa Water Requirement**

**⚠ CRITICAL ⚠**

**POINTS**  
**4**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR 24 - 3138B

Inspector Comments: Measured spa water temperature at 106 F.

**Violation Description:** The allowable water temperature of a spa pool shall not exceed 104°F.

**36K414 Water Quality - Non-Critical - pH High/Low**

**POINTS**  
**2**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR - 65529

Inspector Comments: Measured pH at 7.0.

**Violation Description:** Water shall be maintained in an alkaline condition at a pH between 7.2 and 8.0.



County of San Bernardino • Department of Public Health  
 Division of Environmental Health Services  
**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM**  
**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

(800) 442-2283

FACILITY NAME <b>CUCAMONGA RIDGE INC</b>	DATE <b>7/25/2013</b>	SIGNATURE
LOCATION <b>8717 FOOTHILL BL, RANCHO CUCAMONGA, CA 91730</b>	REHS <b>Anies Kondoker</b>	

### 36K448 Equipment - Flow Meter

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 3125B	Inspector Comments: Repair/replace non-functioning flow meter.
---------------------------	--	--

**Violation Description:** A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

### 36K460 Skimmers - Requirements

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 65533, 3136B	Inspector Comments: Provide weir gate to skimmer.
---------------------------	---	---

**Violation Description:** The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

### 36K466 Structure - Pool Shell

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 3108B	Inspector Comments: Observed spa shell chipped. Ensure that the shell is smooth and non-abrasive.
---------------------------	--	---

**Violation Description:** The finished pool shell shall be lined with a smooth waterproof interior finish that will withstand repeated brushing, scrubbing, and cleaning procedures. The finish color shall be white. Tiles installed at the waterline shall be of contrasting color. A spa pool may be finished in a light color other than white when approved by the enforcing agent. Pool shell shall be maintained in good repair.

### 36K472 Access - Steps - Handrails - Diving Area

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified Not In Compliance Violation Reference - CCR - 3111B, 3113B	Inspector Comments: Fasten 1 loose handrail.
---------------------------	---	--

**Violation Description:** Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

### Overall Inspection Comments

No summary comments have been made for this inspection.

**Photo Attachments:**

No Photo Attachments