



**County of San Bernardino • Department of Public Health  
Division of Environmental Health Services  
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM  
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

**(800) 442-2283**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

FACILITY NAME <b>SUNRIDGE PINES APARTMENTS III</b>				DATE <b>7/30/2013</b>	SIGNATURE
LOCATION <b>9920 19TH ST, RANCHO CUCAMONGA, CA 91701</b>				REINSPECTION DATE <b>1/30/2014</b>	PERMIT EXPIRATION <b>12/31/2013</b>
MAILING ADDRESS <b>10505 SORRENTO VALLEY RD UNIT 300, SAN DIEGO CA 92121</b>				REHS <b>Isaac Gebreslassie</b>	
FA # <b>FA0004825</b>	PR # <b>PR0015214</b>	SR # <b>Not Specified</b>	CO # <b>Not Specified</b>	PE <b>3601</b>	PROGRAM IDENTIFIER: <b>spa-west</b>
TIME IN <b>12:26 PM</b>	TIME OUT <b>12:52 PM</b>	CONTACT <b>Not Captured</b>			SERVICE: <b>001 - Inspection - Routine</b>
					RESULT: <b>03 - Corrective Action / No Follow up Required</b>
					ACTION: <b>01 - No Further Action Required</b>




**RECREATIONAL HEALTH - PUBLIC POOL/SPA**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

**92**  
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

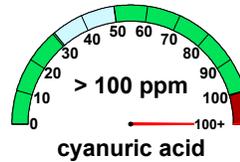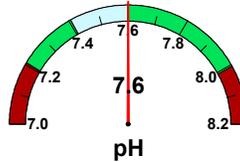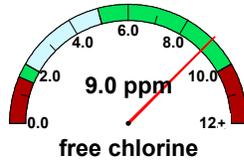

temperature (F)	103.0
observed flow (gpm)	No Data
required flow (gpm)	59
volume (gal)	1,766
area (sq ft)	78
occupancy	7

**36K418 Water Quality - Cyanurates**

**POINTS**  
**2**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR - 65529

**Inspector Comments:** Observed cyanuric acid level too high. Maintain level at below 100 ppm.

**Violation Description:** The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

**36K448 Equipment - Flow Meter**

**POINTS**  
**2**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR - 3125B

**Inspector Comments:** observed flow meter stack. Repair/replace.

**Violation Description:** A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

**36K460 Skimmers - Requirements**

**POINTS**  
**2**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR - 65533, 3136B

**Inspector Comments:** Observed missing weir gate and spring valve. Repalce.

**Violation Description:** The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

**36K466 Structure - Pool Shell**

**POINTS**  
**2**

Compliance Date: Not Specified  
Not In Compliance  
Violation Reference - CCR - 3108B

**Inspector Comments:** Observed pool plaster chipped. Re-plaster for next pool season.

**Violation Description:** The finished pool shell shall be lined with a smooth waterproof interior finish that will withstand repeated brushing, scrubbing, and cleaning procedures. The finish color shall be white. Tiles installed at the waterline shall be of contrasting color. A spa pool may be finished in a light color other than white when approved by the enforcing agent. Pool shell shall be maintained in good repair.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Photo Attachments:**

No Photo Attachments