



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME MISSION VILLAGE APTS				DATE 8/5/2013	SIGNATURE
LOCATION 7781 ARCHIBALD AV, RANCHO CUCAMONGA, CA 91730				REINSPECTION DATE 2/05/2014	PERMIT EXPIRATION 12/31/2013
MAILING ADDRESS 7781 ARCHIBALD AV, RANCHO CUCAMONGA, CA 91730				REHS Isaac Gebreslassie	
FA # FA0007274	PR # PR0014679	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Pool
TIME IN 9:28 AM	TIME OUT 10:00 AM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine
					RESULT: 03 - Corrective Action / No Follow up Required
					ACTION: 01 - No Further Action Required

RECREATIONAL HEALTH - PUBLIC POOL/SPA



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

96

SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

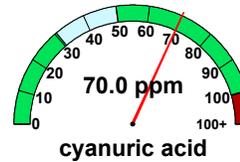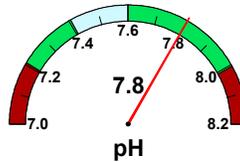

temperature (F)	No Data
observed flow (gpm)	100
required flow (gpm)	111
volume (gal)	40,000
area (sq ft)	1,800
occupancy	90

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - HSC - 3120B,
3132B, 3141B

Inspector Comments: Observed drain pipe from separation tank flowing into a receptacle with missing air gap. Provide at least one in. air gap between tip of drain pipe and rim of floor sink to avoid resyphonage.

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

36K460 Skimmers - Requirements

POINTS
2

Compliance Date: Not Specified
Not In Compliance
Violation Reference - CCR - 65533,
3136B

Inspector Comments: Observed one float assembly and all weir gates missing. Replace missing parts.

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME MISSION VILLAGE APTS	DATE 8/5/2013	SIGNATURE
LOCATION 7781 ARCHIBALD AV, RANCHO CUCAMONGA, CA 91730	REHS Isaac Gebreslassie	

36K429 Safety - Notification - New Sign Requirements

POINTS NA	Compliance Date: Not Specified	Inspector Comments: Observed required signs including CPR, flow direction arrows at water filtration system, and nearest Fire Department phone 3. missing. Ensure all required signs are posted for next pool season.
	Not In Compliance	
	Violation Reference - CCR 24 - 3120B	

Violation Description: Effective September 2012, sign requirements changed. This is not a violation at this time but shall be corrected prior to the 2014 pool season. Failure to comply may result in a violation. The new sign requirements are as follows:

All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- a) Maximum number of pool users permitted for each pool.
- b) "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- c) Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- d) An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- e) The emergency telephone number 911, the number of the nearest emergency services and the name and street address of the pool facility.
- f) A warning sign for spa pools with "CAUTION" language.
- g) Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- h) A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP CLOSED."
- i) A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- j) A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- k) A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments