



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

(800) 442-2283

www.sbcounty.gov/dph/dehs

FACILITY NAME VINTAGE TOWNEHOMES				DATE 8/12/2013	SIGNATURE
LOCATION BAKER & FOOTHILL , RANCHO CUCAMONGA, CA 91730				REINSPECTION DATE 2/12/2014	PERMIT EXPIRATION 12/31/2013
MAILING ADDRESS 1275 CENTER COURT DR, COVINA CA 91724				REHS Anies Kondoker	
FA # FA0004636	PR # PR0015260	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: spa with main pool
TIME IN 9:38 AM	TIME OUT 10:04 AM	CONTACT Not Captured			SERVICE: 001 - Inspection - Routine
				RESULT: 03 - Corrective Action / No Follow up Required	
				ACTION: 01 - No Further Action Required	




RECREATIONAL HEALTH - PUBLIC POOL/SPA

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

94
SCORE

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

Ideal
In Compliance
Not in Compliance

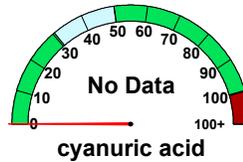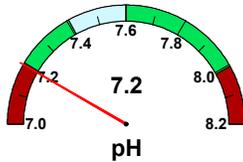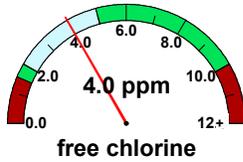

temperature (F)	104.0
observed flow (gpm)	No Data
required flow (gpm)	35
volume (gal)	1,038
area (sq ft)	70
occupancy	7

36K418 Water Quality - Cyanurates

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Measured cyanuric acid above 100 ppm.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Provide a flow meter to the return line.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Replace missing weir gate in the skimmer.
	Not In Compliance	
	Violation Reference - CCR - 65533, 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments