



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME HAMPTON INN & SUITES				DATE 4/4/2014	SIGNATURE <i>Roberto Valentin</i>
LOCATION 250 N 9TH ST, COLTON, CA 92324				REINSPECTION DATE Not Specified	PERMIT EXPIRATION 4/30/2014
MAILING ADDRESS 105 DECKER CT STE 500, IRVING TX 75062				REHS John Babalola	
FA # FA0008659	PR # PR0014088	SR # Not Specified	CO # Not Specified	PE 3605	PROGRAM IDENTIFIER: Spa SERVICE: 001 - INSPECTION - ROUTINE
TIME IN 10:52 AM	TIME OUT 12:03 PM	CONTACT Not Captured			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ ACTION: 01 - NO FURTHER ACTION REQUIRED

RECREATIONAL HEALTH - PUBLIC SPA




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

86

SCORE

Ideal
In Compliance
Not in Compliance

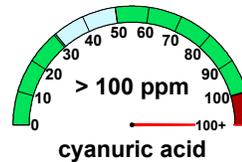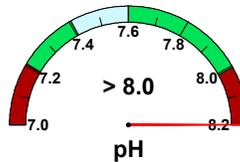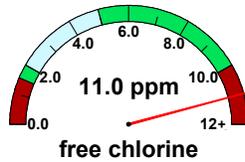

temperature (F)	102.0
observed flow (gpm)	0
required flow (gpm)	60
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

36K404 Water Quality - Critical - High Disinfectant Level

⚠ CRITICAL ⚠

POINTS 4	Compliance Date: Not Specified	Inspector Comments: The free chlorine level is observed above 100 ppm.
	Not In Compliance	Note: Correction is being made. The spa water is being drained and refilled.
	Violation Reference - CCR - 65529	

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K406 Water Quality - Critical - pH High/Low

⚠ CRITICAL ⚠

POINTS 4	Compliance Date: Not Specified	Inspector Comments: The pH level is observed above 8.0
	Not In Compliance	Note: Correction is being made. The spa water is being drained and refilled.
	Violation Reference - CCR - 65529	

Violation Description: Water shall be maintained in an alkaline condition at a pH between 7.2 and 8.0.

36K418 Water Quality - Cyanurates

POINTS 2	Compliance Date: Not Specified	Inspector Comments: The cyanuric acid level is observed above 100 ppm.
	Not In Compliance	Note: Correction is being made. The spa water is being drained and refilled.
	Violation Reference - CCR - 65529	

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

36K446 Equipment - Chlorinator/Heater/Jets

POINTS 2	Compliance Date: Not Specified	Inspector Comments: There is no chlorine tablets inside the automatic chlorinator at the time of inspection.
	Not In Compliance	
	Violation Reference - CCR - 65529, 65535, 3134B...	

Violation Description: Pools, when open or in use, shall be disinfected continuously by a chemical which imparts a residual effect. Disinfectant feeders shall comply with applicable requirements established by the NSF/ANSI 50-2010 performance standard effective August 2010 for disinfectant feeders. All feeders shall be capable of supplying not less than the equivalent of 3 pounds of 100 percent available chlorine per day per 10,000 gallons of pool water capacity. All parts of the pool and related pool facilities and equipment shall be maintained in good repair. A spa pool aeration and/or jet system shall be completely separate from the recirculation system and shall not be interconnected with any other pool.

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Replace/repair the non-functional flow meter.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME HAMPTON INN & SUITES	DATE 4/4/2014	SIGNATURE <i>Roberto Valerino</i>
LOCATION 250 N 9TH ST, COLTON, CA 92324	REHS John Babalola	

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments