



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME NOVA POINTE					DATE 4/29/2014	SIGNATURE <i>M. L. Sontell</i>	
LOCATION 800 E WASHINGTON, COLTON, CA 92324					REINSPECTION DATE 10/29/2014	PERMIT EXPIRATION 7/31/2014	
MAILING ADDRESS 800 E WASHINGTON, COLTON, CA 92324					REHS John Babalola		
FA # FA0006153	PR # PR0015441	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: pool phase 1 by ofc SERVICE: 001 - INSPECTION - ROUTINE		
TIME IN 9:41 AM	TIME OUT 10:27 AM	CONTACT Not Captured			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ ACTION: 01 - NO FURTHER ACTION REQUIRED		

RECREATIONAL HEALTH - PUBLIC POOL




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

88

SCORE

Ideal
In Compliance
Not in Compliance

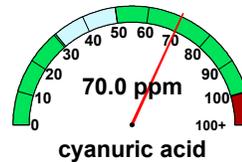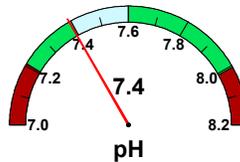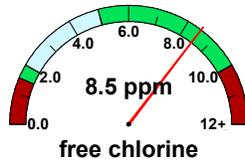

temperature (F)	No Data
observed flow (gpm)	60
required flow (gpm)	80
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

36K430 Safety - Equipment/First Aid Kit

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Replace the missing life ring.
	Not In Compliance	
	Violation Reference - CCR - 65539	

Violation Description: Every swimming pool shall be equipped for safety and rescue purposes with one or more rescue poles not less than 12 feet in length with body hooks, and one or more life rings having a minimum exterior diameter of 17 inches readily accessible for use. Such life rings shall have attached to them an 3/16 inch line long enough to span the maximum width of the pool. A first aid kit shall be provided at all swimming pools when required by DEHS.

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Provide and label the flow directions on the pipes in the equipment room.
	Not In Compliance	
	Violation Reference - HSC - 3120B, 3132B, 3141B	

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

36K446 Equipment - Chlorinator/Heater/Jets

POINTS 2	Compliance Date: Not Specified	Inspector Comments: No chlorine tablets observed inside the automatic chlorinator.
	Not In Compliance	
	Violation Reference - CCR - 65529, 65535, 3134B...	

Violation Description: Pools, when open or in use, shall be disinfected continuously by a chemical which imparts a residual effect. Disinfectant feeders shall comply with applicable requirements established by the NSF/ANSI 50-2010 performance standard effective August 2010 for disinfectant feeders. All feeders shall be capable of supplying not less than the equivalent of 3 pounds of 100 percent available chlorine per day per 10,000 gallons of pool water capacity. All parts of the pool and related pool facilities and equipment shall be maintained in good repair. A spa pool aeration and/or jet system shall be completely separate from the recirculation system and shall not be interconnected with any other pool.



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME NOVA POINTE		DATE 4/29/2014	SIGNATURE <i>M. L. Sontell</i>
LOCATION 800 E WASHINGTON , COLTON, CA 92324		REHS John Babalola	

36K458 Maintenance - Test Kit/Daily Records

POINTS 2	Compliance Date: Not Specified	Inspector Comments: No daily records of pH and chlorine readings observed.
	Not In Compliance	
Violation Reference - CCR - 65523, 65529		

Violation Description: Appropriate test kits for measuring the pH, concentration of the disinfectant, and, when used, concentration of cyanuric acid shall be provided at each pool. The test kit shall be capable of testing for free chlorine residual.

The operator of each pool open for use shall keep a daily record of information regarding operation, including readings of disinfectant residual, pH and maintenance procedures such as cleaning of filters and quantity of chemicals used.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Replace the missing skimmer weir gates.
	Not In Compliance	
Violation Reference - CCR - 65533, 3136B		

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K472 Access - Steps - Handrails - Diving Area

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Secure the unstable hand rails.
	Not In Compliance	
Violation Reference - CCR - 3111B, 3113B		

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments