



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME HILTON GARDEN INN SAN BERNARDINO				DATE 5/2/2014	SIGNATURE
LOCATION 1755 S WATERMAN AV, SAN BERNARDINO, CA 92408				REINSPECTION DATE Not Specified	PERMIT EXPIRATION 7/31/2014
MAILING ADDRESS 42 CORPORATE PARK STE 200, IRVINE CA 92606				REHS Yong Aday	
FA # FA0018426	PR # PR0024474	SR # Not Specified	CO # Not Specified	PE 3605	PROGRAM IDENTIFIER: SPA
TIME IN 10:06 AM	TIME OUT 10:34 AM	CONTACT Not Captured			SERVICE: 001 - INSPECTION - ROUTINE
					RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ
					ACTION: 01 - NO FURTHER ACTION REQUIRED

RECREATIONAL HEALTH - PUBLIC SPA




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

92

SCORE

Ideal
In Compliance
Not in Compliance

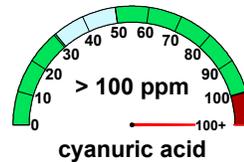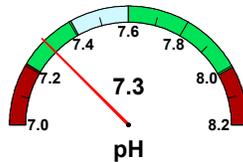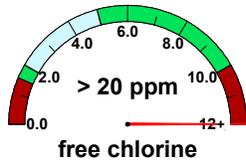

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

36K404 Water Quality - Critical - High Disinfectant Level

⚠ CRITICAL ⚠

POINTS 4	Compliance Date: Not Specified	Inspector Comments: Observed chlorine level at 20.5ppm in the spa.
	Not In Compliance	Operator drained approximately half volume of the spa on site and started to refill it with fresh water. Test the water after the spa is refilled. Do not use the spa until chlorine level is at 1.5-10ppm.
	Violation Reference - CCR - 65529	

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K418 Water Quality - Cyanurates

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed above 100ppm cyanuric acid level in the spa.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: The cyanuric acid concentration in any pool shall not exceeded 100 ppm.

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Mark direction of flow on all piping of the recirculation system.
	Not In Compliance	
	Violation Reference - HSC - 3120B, 3132B, 3141B	

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments