



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME SUN TREE APARTMENTS				DATE 5/20/2014	SIGNATURE
LOCATION 1551 W RIALTO AV, FONTANA, CA 92335				REINSPECTION DATE 11/20/2014	PERMIT EXPIRATION 3/31/2015
MAILING ADDRESS 8150 COTTONWOOD AV, FONTANA CA 92335				REHS Chris Nwadike	
FA # FA0005307	PR # PR0015107	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Pool
TIME IN 10:06 AM	TIME OUT 11:12 AM	CONTACT Not Captured			SERVICE: 001 - INSPECTION - ROUTINE
					RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ
					ACTION: 01 - NO FURTHER ACTION REQUIRED

RECREATIONAL HEALTH - PUBLIC POOL




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

88

SCORE

Ideal
In Compliance
Not in Compliance

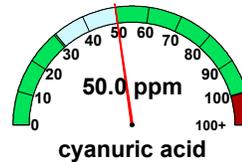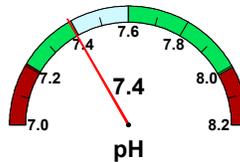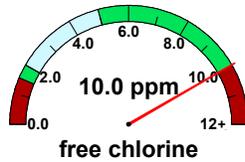

temperature (F)	76.0
observed flow (gpm)	0
required flow (gpm)	60
volume (gal)	21,500
area (sq ft)	690
occupancy	24

36K402 Water Quality - Critical - Lack of Disinfectant



POINTS 4	Compliance Date: Not Specified	Inspector Comments: Observed chlorine level at 1.0ppm. Maintain chlorine level between 1.5 and 10.0ppm. Corrected to 10.0ppm during inspection.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: For pools using hypochlorite or gaseous chlorine without a stabilizer, a free chlorine residual at least 1.0 ppm shall be maintained throughout the pool. If cyanuric acid or a chlorinated isocyanurate is used, a free chlorine residual of at least 1.5 ppm shall be maintained throughout the pool.

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed no labels/markings showing the direction of water recirculation on all piping in the equipment/pump area. Label/mark the direction of water recirculation on all piping in the equipment/pump area.
	Not In Compliance	
	Violation Reference - HSC - 3120B, 3132B, 3141B	

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

36K446 Equipment - Chlorinator/Heater/Jets

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed no disinfectant feeder installed in the recirculation system. Install the feeder. All feeders shall be capable of supplying 3 pounds of chlorine per 10,000 gallons of pool water per day.
	Not In Compliance	
	Violation Reference - CCR - 65529, 65535, 3134B...	

Violation Description: Pools, when open or in use, shall be disinfected continuously by a chemical which imparts a residual effect. Disinfectant feeders shall comply with applicable requirements established by the NSF/ANSI 50-2010 performance standard effective August 2010 for disinfectant feeders. All feeders shall be capable of supplying not less than the equivalent of 3 pounds of 100 percent available chlorine per day per 10,000 gallons of pool water capacity. All parts of the pool and related pool facilities and equipment shall be maintained in good repair. A spa pool aeration and/or jet system shall be completely separate from the recirculation system and shall not be interconnected with any other pool.

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed no flow meter. Install the flow meter.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME SUN TREE APARTMENTS	DATE 5/20/2014	SIGNATURE
LOCATION 1551 W RIALTO AV, FONTANA, CA 92335		REHS Chris Nwadike

36K472 Access - Steps - Handrails - Diving Area

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed loose hand rails. Tighten the hand rails.
	Not In Compliance	
Violation Reference - CCR - 3111B, 3113B		

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments