



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME TIMBERLINE LODGE					DATE 6/5/2014	SIGNATURE <i>Fendi</i>	
LOCATION 39921 BIG BEAR BL, BIG BEAR LAKE, CA 92315					REINSPECTION DATE 12/05/2014	PERMIT EXPIRATION 12/31/2014	
MAILING ADDRESS PO BOX 1955, BIG BEAR LAKE CA 92315					REHS Sierra Clayborn		
FA # FA0006791	PR # PR0015806	SR # Not Specified	CO # Not Specified	PE 3601	PROGRAM IDENTIFIER: Pool		
TIME IN 2:51 PM	TIME OUT 3:38 PM	CONTACT Not Captured			SERVICE: 001 - INSPECTION - ROUTINE		
					RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ		
					ACTION: 01 - NO FURTHER ACTION REQUIRED		

RECREATIONAL HEALTH - Public Pool



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

92

SCORE

Ideal
In Compliance
Not in Compliance

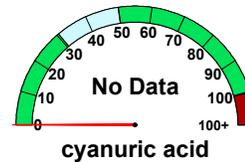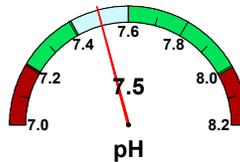

temperature (F)	81.0
observed flow (gpm)	50
required flow (gpm)	29
volume (gal)	14,344
area (sq ft)	510
occupancy	25

36K458 Maintenance - Test Kit/Daily Records

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed pool chemical testing records filled out with information until June 8, 2014; date of inspection is June 5, 2014. Ensure that records are taken daily for accuracy.
	Not In Compliance	
	Violation Reference - CCR - 65523, 65529	

Violation Description: Appropriate test kits for measuring the pH, concentration of the disinfectant, and, when used, concentration of cyanuric acid shall be provided at each pool. The test kit shall be capable of testing for free chlorine residual.

The operator of each pool open for use shall keep a daily record of information regarding operation, including readings of disinfectant residual, pH and maintenance procedures such as cleaning of filters and quantity of chemicals used.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed spring assembly missing from both skimmers.
	Not In Compliance	
	Violation Reference - CCR - 65533, 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K472 Access - Steps - Handrails - Diving Area

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed hand rails at 4.5 ft depth of pool loose. *Corrected during inspection.
	Not In Compliance	
	Violation Reference - CCR - 3111B, 3113B	

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME TIMBERLINE LODGE	DATE 6/5/2014	SIGNATURE <i>Fendi</i>
LOCATION 39921 BIG BEAR BL, BIG BEAR LAKE, CA 92315		REHS Sierra Clayborn

36K474 Lighting - Adequate Lighting and Ventilation

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed pool light at 4.5 ft depth with water in it and both lights at deep and shallow end not turning on during inspection. GFCI was not able to be tested during inspection. Repair as soon as possible. Lights must work during evening/night as a safety precaution for drowning and electrical shock.
	Not In Compliance Violation Reference - SBCC - 3115B, 3106B, 3121B	

Violation Description: Pools used at night shall be equipped with underwater lighting fixtures that will provide complete illumination to all underwater areas of the pool with no blind spots. Pool deck areas and emergency egress areas shall be provided with lighting so that persons walking on the deck can identify hazards. Lighting fixtures shall be aimed towards the deck area and away from the pool surface insofar as practical. Artificial lighting shall be provided at all spray ground pads which are used at night or which do not have adequate natural lighting so that all portions of the spray pad and deck may be seen easily.

Indoor pools, dressing rooms and toilet rooms shall be ventilated according to the requirements in Chapter 4 of the California Mechanical Code.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments