



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME SUN CHASE COMM POOL & SPA				DATE 6/4/2014	SIGNATURE
LOCATION 31027 MOSS ST, MENTONE, CA 92359				REINSPECTION DATE Not Specified	PERMIT EXPIRATION 9/30/2014
MAILING ADDRESS 9231 ARCHIBALD AV, RANCHO CUCAMONGA CA 91730				REHS Cecilia Jones	
FA # FA0005105	PR # PR0015159	SR # Not Specified	CO # Not Specified	PE 3605	PROGRAM IDENTIFIER: spa SERVICE: 001 - INSPECTION - ROUTINE
TIME IN 10:49 AM	TIME OUT 11:03 AM	CONTACT Not Captured			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ ACTION: 01 - NO FURTHER ACTION REQUIRED

RECREATIONAL HEALTH - Public Spa




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

88

SCORE

Ideal
In Compliance
Not in Compliance

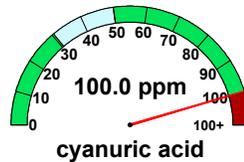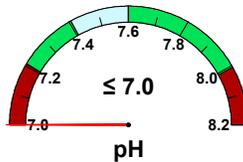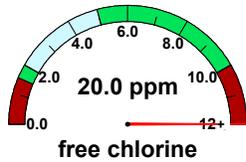

temperature (F)	80.0
observed flow (gpm)	0
required flow (gpm)	7
volume (gal)	2,520
area (sq ft)	95
occupancy	6

36K404 Water Quality - Critical - High Disinfectant Level

⚠ CRITICAL ⚠

POINTS 4	Compliance Date: Not Specified	Inspector Comments: Observed chlorine concentration at 20 ppm. Maintain between 1.5 and 10 ppm. Pool service was on site during the inspection and immediately made corrections.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K406 Water Quality - Critical - pH High/Low

⚠ CRITICAL ⚠

POINTS 4	Compliance Date: Not Specified	Inspector Comments: Observed pH at 7.0. Maintain between 7.2 and 8.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: Water shall be maintained in an alkaline condition at a pH between 7.2 and 8.0.

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed flow meter is stuck. Repair and ensure that water is recirculating at a minimum rate of 7 GPM for this spa.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed no soap or paper towels in the rest room. For proper hand washing, keep well stocked.
	Not In Compliance	
	Violation Reference - CCR - 65535, 65551, 3117B	

Violation Description: Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.

Overall Inspection Comments

No summary comments have been made for this inspection.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME SUN CHASE COMM POOL & SPA	DATE 6/4/2014	SIGNATURE
LOCATION 31027 MOSS ST, MENTONE, CA 92359		REHS Cecilia Jones

Photo Attachments:

No Photo Attachments