



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME FERNROCK ESTATES					DATE 6/12/2014	SIGNATURE	
LOCATION 872 SIERRA VISTA DR, TWIN PEAKS, CA 92391					REINSPECTION DATE Not Specified	PERMIT EXPIRATION 5/31/2015	
MAILING ADDRESS 1420 N CLAREMONT BL STE 205-D, CLAREMONT CA 91711					REHS Breyanna Lyles		
FA # FA0001438	PR # PR0015696	SR # Not Specified	CO # Not Specified	PE 3620	PROGRAM IDENTIFIER: Pool SERVICE: 001 - INSPECTION - ROUTINE		
TIME IN 3:35 PM	TIME OUT 4:10 PM	CONTACT Not Captured			RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQUIRED ACTION: 13 - PERMIT SUSPENDED / FACILITY CLOSED		



RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

88

SCORE

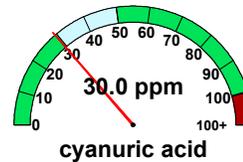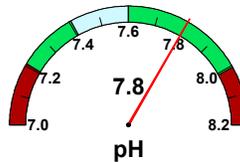

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	No Data
volume (gal)	No Data
area (sq ft)	No Data
occupancy	No Data

36K402 Water Quality - Critical - Lack of Disinfectant



POINTS 4	Compliance Date: Not Specified	Inspector Comments: Measured chlorine in pool at 0ppm. Facility must provide chlorine measuring at least 1.0ppm without cyanuric acid and 1.5 with cyanuric acid. Pool operator was called to site during inspection to correct chlorine levels. Follow-up inspection will be conducted prior to use.
	Not In Compliance	
	Violation Reference - CCR - 65529	

Violation Description: For pools using hypochlorite or gaseous chlorine without a stabilizer, a free chlorine residual at least 1.0 ppm shall be maintained throughout the pool. If cyanuric acid or a chlorinated isocyanurate is used, a free chlorine residual of at least 1.5 ppm shall be maintained throughout the pool.

36K427 Safety - Safety Signs

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed following signs missing: -CPR Procedures -emergency sign that includes local emergency number and address of pool facility -"No persons having active diarrhea or have had diarrhea in the past 14 days shall be allowed to enter the pool"
	Not In Compliance	
	Violation Reference - CCR 24 - 3120B	

Violation Description: All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- Maximum number of pool users permitted for each pool.
- "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- A warning sign for spa pools with "CAUTION" language.
- Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP GATE CLOSED" or "KEEP DOOR CLOSED".
- A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME FERNROCK ESTATES	DATE 6/12/2014	SIGNATURE
LOCATION 872 SIERRA VISTA DR, TWIN PEAKS, CA 92391	REHS Breyanna Lyles	

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed no directional arrows on piping in equipment room. Provide directional arrows showing the flow of water through equipment.
	Not In Compliance	
	Violation Reference - HSC - 3120B, 3132B, 3141B	

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

36K472 Access - Steps - Handrails - Diving Area

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed loose handrail. Secure handrail.
	Not In Compliance	
	Violation Reference - CCR - 3111B, 3113B	

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed faucets for hot water not functioning at hand-washing sinks in both mens and womens restrooms. Provide warm water (at least 100F) at hand-washing sinks.
	Not In Compliance	
	Violation Reference - CCR - 65535, 65551, 3117B	

Violation Description: Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments