



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME CUCAMONGA RIDGE INC					DATE 6/20/2014	SIGNATURE	
LOCATION 8717 FOOTHILL BL, RANCHO CUCAMONGA, CA 91730					REINSPECTION DATE Not Specified	PERMIT EXPIRATION 5/31/2015	
MAILING ADDRESS 8717 FOOTHILL BL, RANCHO CUCAMONGA, CA 91730					REHS Anies Kondoker		
FA # FA0010720	PR # PR0013989	SR # Not Specified	CO # Not Specified	PE 3620	PROGRAM IDENTIFIER: Pool SERVICE: 001 - INSPECTION - ROUTINE		
TIME IN 10:39 AM	TIME OUT 11:23 AM	CONTACT Not Captured			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ ACTION: 01 - NO FURTHER ACTION REQUIRED		

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

90

SCORE

Ideal
In Compliance
Not in Compliance

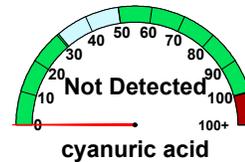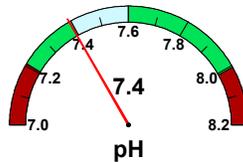

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	137
volume (gal)	49,000
area (sq ft)	1,467
occupancy	73

36K427 Safety - Safety Signs

POINTS	Compliance Date: Not Specified
2	Not In Compliance
	Violation Reference - CCR 24 - 3120B

Inspector Comments: Observed faded pool safety signs. Observed some round stickers posted on safety signs and covering some writings on the signs. Replace. New signs shall meet the new pool safety sign requirements.

- Observed missing the following safety signs:
- 911 (has to be 4" high)
 - name and address of pool location
 - phone number of nearest emergency service
 - illustrated diagram with text at least ¼ inch high of CPR procedures

Ensure to provide the above safety signs by July 1, 2014 to avoid a charged inspection.

Violation Description: All signs shall have clearly legible letters or numbers not less than 4 inches high, unless otherwise required, affixed to a wall, pole, gate or similar permanent structure in a location visible to all pool users. The following shall be posted:

- Maximum number of pool users permitted for each pool.
- "NO DIVING" at pools with a maximum water depth of 6 feet or less.
- Where no lifeguard service is provided, a warning sign shall be posted stating, "WARNING: NO LIFEGUARD ON DUTY." The sign also shall state in letters at least 1 inch high, "Children under the age of 14 shall not use pool without a parent or adult guardian in attendance."
- An illustrated diagram with text at least 1/4 inch high of artificial respiration and CPR procedures.
- The emergency telephone number 911 with numbers not less than 4 inches (102mm), the number of the nearest emergency services and the name and street address of the pool facility with numbers and text not less than 1 inch (25 mm) shall be posted.
- A warning sign for spa pools with "CAUTION" language.
- Where pools were constructed for which lighting was not required, a sign shall be posted at each pool entrance on the outside of the gate(s) stating, "NO USE OF POOL ALLOWED AFTER DARK."
- A sign shall be posted on the exterior side of gates and doors leading into the pool enclosure area stating, "KEEP GATE CLOSED" or "KEEP DOOR CLOSED".
- A sign in letters at least 1 inch high and in a language or diagram that is clearly stated shall be posted at the entrance area of a public pool which states that persons having currently active diarrhea or who have had active diarrhea within the previous 14 days shall not be allowed to enter the pool water.
- A sign in letters at least 1 inch high shall be posted that describes the requirements for wave pools.
- A sign shall be posted at each spray ground and be visible from any part of the spray ground that states, "CAUTION: WATER IS RECIRCULATED. DO NOT DRINK."



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME CUCAMONGA RIDGE INC	DATE 6/20/2014	SIGNATURE
LOCATION 8717 FOOTHILL BL, RANCHO CUCAMONGA, CA 91730	REHS Anies Kondoker	

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed direction of flow for recirculation system not labeled. Ensure to clearly label recirculation equipment with directional symbols.
	Not In Compliance	
	Violation Reference - HSC - 3120B, 3132B, 3141B	

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed non-functional flow meter. Repair/replace. Ensure that the recirculation system is able to achieve flow rate at about 137 gpm.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

36K476 Decking - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed some missing/broken expansion joint near north skimmer. Repair.
	Not In Compliance	
	Violation Reference - CCR - 3114B	

Violation Description: A minimum continuous and unobstructed 4-foot wide slip resistant, cleanable, nonabrasive deck area of concrete or like material shall be provided flush with the top of the pool coping extending completely around the pool, and the deck area shall further extend 4 feet both sides and rear of any diving board, fixed disabled access assistance device or slide and their appurtenances. Deck shall be maintained in good repair.

36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed no hot water in both men and women restrooms. Ensure to provide hot water to restrooms and shower,
	Not In Compliance	
	Violation Reference - CCR - 65535, 65551, 3117B	Observed broken shower. Repair/replace.

Violation Description: Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.

Overall Inspection Comments

No summary comments have been made for this inspection.

Photo Attachments:

No Photo Attachments