



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME INLAND EMPIRE JOB CORPS					DATE 6/23/2014	SIGNATURE	
LOCATION 3173 KERRY ST, SAN BERNARDINO, CA 92407					REINSPECTION DATE Not Specified	PERMIT EXPIRATION 6/30/2014	
MAILING ADDRESS 3173 KERRY ST, SAN BERNARDINO CA 92407					REHS Sumedha Singh		
FA # FA0005610	PR # PR0007348	SR # Not Specified	CO # Not Specified	PE 3620	PROGRAM IDENTIFIER: Pool		
TIME IN 9:30 AM	TIME OUT 10:10 PM	CONTACT Not Captured			SERVICE: 001 - INSPECTION - ROUTINE		
					RESULT: 05 - CORRECTIVE ACTION / FOLLOW UP REQUIRED		
					ACTION: 03 - REINSPECTION REQUIRED		

RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

88

SCORE

Ideal
In Compliance
Not in Compliance

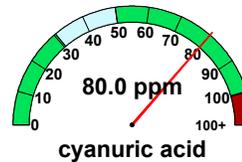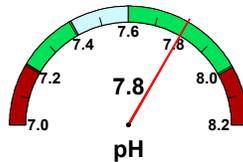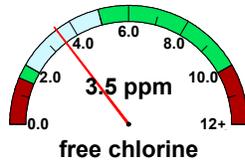

temperature (F)	No Data
observed flow (gpm)	60
required flow (gpm)	140
volume (gal)	67,500
area (sq ft)	1,800
occupancy	90

36K995 Permit - Suspension

⚠ CRITICAL ⚠

POINTS NA	Compliance Date: Not Specified	Inspector Comments: Health permit for the pool is hereby suspended due to water in the light fixture in the shallow end. Contact DEHS prior to opening the pool when the light fixture is repaired.
	Not In Compliance	
	Violation Reference - HSC	

Violation Description: Violation(s) observed pose an immediate threat to public health and safety. The health permit to operate is hereby suspended and the pool/spa ordered closed until the listed violation(s) have been corrected and verified by Environmental Health Services (EHS). The facility is to remain closed until permission from EHS is given. Contact your inspector at your local office to schedule a reinspection to reinstate the health permit. The facility is posted closed; do not move, hide, or remove the sign. Reopening of the pool/spa without the approval by EHS, may result in an hourly billable Professional Services fee.

36K422 Safety - Critical - Unsafe/Hazardous Conditions

⚠ CRITICAL ⚠

POINTS 4	Compliance Date: Not Specified	Inspector Comments: Observed water inside the pool light in the shallow end. Operator stated the light was disconnected. Repair immediately and maintain as needed. Operator shall repair the light within 30 days.
	Not In Compliance	
	Violation Reference - CCR - 116040, 65545, 116049	

Violation Description: Every person operating or maintaining a public swimming pool must do so in a sanitary, healthful and safe manner. Unhealthful, unsafe or unsanitary conditions include, but are not limited to, the failure to meet clarity, disinfection, pH, safety or bacteriological standards, broken glass on pool deck, electrical hazard; chemical storage.

All dry-niche light fixtures, and all underwater wet-niche light fixtures operating at more than 15 volts in public swimming pools shall be protected by a ground-fault circuit interrupter in the branch circuit, and all light fixtures in public swimming pools shall have encapsulated terminals. The ground-fault circuit interrupter shall comply with Underwriter's Laboratory standards.

36K452 Maintenance - Flow Rate/Turnover Time

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed flow meter in equipment room reading approximately 60 gpm. Flow meter should be functioning at a minimum of 140 gpm for a turnover rate of 8 hours due to being built prior to 1982.
	Not In Compliance	
	Violation Reference - CCR 24 - 3124B	

Violation Description: The recirculation system shall have the capacity to provide a complete turnover of pool water in:

1. One-half hour or less for a spa pool;
2. One-half hour or less for a spray ground;
3. One hour or less for a wading pool;
4. Two hours or less for a medical pool; and
5. Six hours or less for all other types of public pools.

The variation in flow of an operating recirculation system shall be such as not to reduce the flow below 75 percent of the rate required.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME INLAND EMPIRE JOB CORPS	DATE 6/23/2014	SIGNATURE
LOCATION 3173 KERRY ST, SAN BERNARDINO, CA 92407	REHS Sumedha Singh	

36K462 Plumbing - Backflow Protection

POINTS 2	Compliance Date: Not Specified Not In Compliance	Inspector Comments: Observed closed loop system in equipment room. Backwash water is plumbed back into pool return line. Closed loop systems are not allowed. Wastewater shall be disposed of properly.
	Violation Reference - CCR - 3141B, 3118B	

Violation Description: There shall be no direct connection between any potable water supply system and the pool or its piping system unless protected by a backflow prevention device in accordance with Chapter 6 of the California Plumbing Code.
There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system.
Potable water outlets with hose attachments shall be protected by a nonremovable hose bibb backflow preventer, a nonremovable hose bibb vacuum breaker, or by an atmospheric vacuum breaker.

36K466 Structure - Pool Shell

POINTS 2	Compliance Date: Not Specified Not In Compliance	Inspector Comments: Observed broken tiles near the shallow and deep end of the pool. Repair and maintain as needed.
	Violation Reference - CCR - 3108B	

Violation Description: The finished pool shell shall be lined with a smooth waterproof interior finish that will withstand repeated brushing, scrubbing, and cleaning procedures. The finish color shall be white. Tiles installed at the waterline shall be of contrasting color. A spa pool may be finished in a light color other than white when approved by the enforcing agent. Pool shell shall be maintained in good repair.

36K468 Construction - Markings

POINTS 2	Compliance Date: Not Specified Not In Compliance	Inspector Comments: Observed large facility logo at the bottom of the pool. No marking, designs or lettering is permitted on the pool shell. Logo shall be removed.
	Violation Reference - CCR - 3110B	

Violation Description: The water depth shall be clearly marked at the following locations: maximum depth; minimum depth; each end; both sides at each end; at the break in the bottom slope between the shallow and deep portions of the pool; and along the perimeter of the pool at distances not to exceed 25 feet. Pools with a maximum water depth greater than 5 feet shall have a slip resistant tile a minimum of 4 inches and not greater than 6 inches wide of a color contrasting with the background of the pool shell across the bottom of the pool where the water depth is 4 1/2 feet. For pool water depths 6 feet and shallower no diving markers with the universal symbol of no diving shall be installed on the deck directly adjacent to the depth markers.

No markings, designs or lettering shall be permitted on the pool shell except for slip resistant lane markings, depth marking lines and safety markings.

Overall Inspection Comments

Pool closed for light fixture. Call DEHS at 1.800.442.2283 for re-opening.

Photo Attachments:

No Photo Attachments