



County of San Bernardino • Department of Public Health  
 Division of Environmental Health Services  
**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM**  
**RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

(800) 442-2283

FACILITY NAME <b>MEADOWOOD VILLAGE</b>					DATE <b>7/3/2014</b>	SIGNATURE	
LOCATION <b>10153 SHADY OAKS DR, RANCHO CUCAMONGA, CA 91730</b>					REINSPECTION DATE <b>Not Specified</b>	PERMIT EXPIRATION <b>9/30/2014</b>	
MAILING ADDRESS <b>1235 E FRANCIS ST STE E, ONTARIO CA 91761</b>					REHS <b>Nick Thalasinios</b>		
FA # <b>FA0006124</b>	PR # <b>PR0016916</b>	SR # <b>Not Specified</b>	CO # <b>Not Specified</b>	PE <b>3623</b>	PROGRAM IDENTIFIER: Spa		
TIME IN <b>5:15 PM</b>	TIME OUT <b>5:35 PM</b>	CONTACT <b>Not Captured</b>			SERVICE: 001 - INSPECTION - ROUTINE		
					RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ		
					ACTION: 01 - NO FURTHER ACTION REQUIRED		

**RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility**




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

**92**

SCORE

Ideal
In Compliance
Not in Compliance

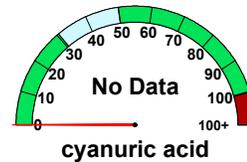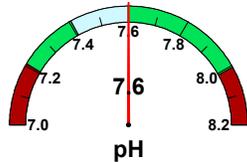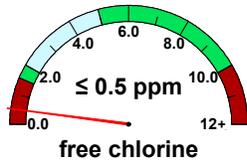

temperature (F)	91.3
observed flow (gpm)	No Data
required flow (gpm)	60
volume (gal)	1,798
area (sq ft)	80
occupancy	8

**36K448 Equipment - Flow Meter**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed the flow meter is stuck; Flowmeter shall be maintained in good repair, accurately displaying flowrate.
	Not In Compliance	
	Violation Reference - CCR - 3125B	

**Violation Description:** A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

**36K462 Plumbing - Backflow Protection**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed the House ends in the drain line; Add a vacuum breaker to the hose faucet.
	Not In Compliance	
	Violation Reference - CCR - 3141B, 3118B	

**Violation Description:** There shall be no direct connection between any potable water supply system and the pool or its piping system unless protected by a backflow prevention device in accordance with Chapter 6 of the California Plumbing Code. There shall be no direct connection between the pool, its recirculation system or overflow drain to any sanitary sewer, storm drain or drainage system. Potable water outlets with hose attachments shall be protected by a nonremovable hose bibb backflow preventer, a nonremovable hose bibb vacuum breaker, or by an atmospheric vacuum breaker.

**36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain**

<b>POINTS</b> <b>2</b>	Compliance Date: Not Specified	<b>Inspector Comments:</b> Observed no Hot water; Showers and lavatories shall be provided with hot and cold water faucets (Tempered water shall be permitted in lieu of individual hot and cold water faucets).
	Not In Compliance	
	Violation Reference - CCR - 65535, 65551, 3117B	

**Violation Description:** Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM  
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

**(800) 442-2283**

FACILITY NAME <b>MEADOWOOD VILLAGE</b>	DATE <b>7/3/2014</b>	SIGNATURE
LOCATION <b>10153 SHADY OAKS DR, RANCHO CUCAMONGA, CA 91730</b>		REHS <b>Nick Thalasin</b>

**36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain**

<b>POINTS</b> <b>2</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Observed no jet drinking fountain; One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.
	Not In Compliance	
	Violation Reference - <b>CCR - 65535, 65551, 3117B</b>	

**Violation Description:** Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.

**Overall Inspection Comments**

Spa Inspection

**Photo Attachments:**  
No Photo Attachments