



**County of San Bernardino • Department of Public Health  
Division of Environmental Health Services  
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM  
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

[www.sbcounty.gov/dph/dehs](http://www.sbcounty.gov/dph/dehs)

**(800) 442-2283**

FACILITY NAME <b>LIFESTYLE APARTMENTS</b>					DATE <b>7/22/2014</b>	SIGNATURE	
LOCATION <b>16324 MERRILL AV, FONTANA, CA 92335</b>					REINSPECTION DATE <b>Not Specified</b>	PERMIT EXPIRATION <b>9/30/2014</b>	
MAILING ADDRESS <b>8150 COTTONWOOD AV, FONTANA CA 92335</b>					REHS <b>Chris Nwadike</b>		
FA # <b>FA0006522</b>	PR # <b>PR0013587</b>	SR # <b>Not Specified</b>	CO # <b>Not Specified</b>	PE <b>3620</b>	PROGRAM IDENTIFIER: Pool SERVICE: 001 - INSPECTION - ROUTINE		
TIME IN <b>4:03 PM</b>	TIME OUT <b>4:46 PM</b>	CONTACT <b>Not Captured</b>			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ ACTION: 01 - NO FURTHER ACTION REQUIRED		




**RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility**

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

**96**

SCORE

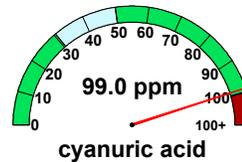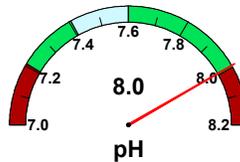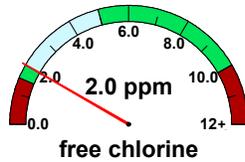

temperature (F)	82.0
observed flow (gpm)	0
required flow (gpm)	56
volume (gal)	20,266
area (sq ft)	648
occupancy	32

**36K444 Equipment - Recirculation Pump/Filter/Separation Tank**

<b>POINTS</b> <b>2</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Observed no labels/markings showing the direction of water recirculation on all piping in the equipment/pump area. Label/mark the direction of water recirculation on all piping in the equipment/pump area.
	<b>Not In Compliance</b>	
	Violation Reference - <b>HSC - 3120B, 3132B, 3141B</b>	

**Violation Description:** Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

**36K448 Equipment - Flow Meter**

<b>POINTS</b> <b>2</b>	Compliance Date: <b>Not Specified</b>	<b>Inspector Comments:</b> Observed non functioning flow meter. Repair or replace.
	<b>Not In Compliance</b>	
	Violation Reference - <b>CCR - 3125B</b>	

**Violation Description:** A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.

**Overall Inspection Comments**

No summary comments have been made for this inspection.

**Photo Attachments:**

No Photo Attachments