



**County of San Bernardino • Department of Public Health
Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME REDLANDS HIGH SCHOOL					DATE 8/18/2014	SIGNATURE	
LOCATION 840 E CITRUS AV, REDLANDS, CA 92373					REINSPECTION DATE 2/18/2015	PERMIT EXPIRATION	
MAILING ADDRESS 840 E CITRUS AV, REDLANDS, CA 92373					REHS Sierra Clayborn		
FA # FA0006492	PR # PR0014836	SR # Not Specified	CO # Not Specified	PE 3603	PROGRAM IDENTIFIER: Shallow Pool		
TIME IN 8:47 AM	TIME OUT 9:59 AM	CONTACT Not Captured			SERVICE: 001 - INSPECTION - ROUTINE		
					RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ		
					ACTION: 01 - NO FURTHER ACTION REQUIRED		

RECREATIONAL HEALTH - Public School Pool / Spa




Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

96

SCORE

Ideal
In Compliance
Not in Compliance

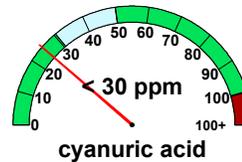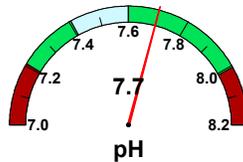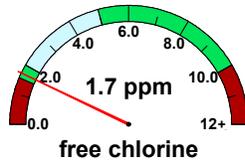

temperature (F)	82.5
observed flow (gpm)	384
required flow (gpm)	360
volume (gal)	129,938
area (sq ft)	3,850
occupancy	192

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed algae in portions of gutter in shallow pool (4-5ft deep). Operator stated that portions of gutter system do not drain, but areas are treated on a regular basis to reduce algae growth in gutter trough.
	Not In Compliance	
	Violation Reference - CCR - 65533, 3136B	

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K474 Lighting - Adequate Lighting and Ventilation

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed 1 light on right hand side of shallow pool near 4 ft end not working during inspection. Replace bulb/repair light.
	Not In Compliance	
	Violation Reference - SBCC - 3115B, 3106B, 3121B	

Violation Description: Pools used at night shall be equipped with underwater lighting fixtures that will provide complete illumination to all underwater areas of the pool with no blind spots. Pool deck areas and emergency egress areas shall be provided with lighting so that persons walking on the deck can identify hazards. Lighting fixtures shall be aimed towards the deck area and away from the pool surface insofar as practical. Artificial lighting shall be provided at all spray ground pads which are used at night or which do not have adequate natural lighting so that all portions of the spray pad and deck may be seen easily.

Indoor pools, dressing rooms and toilet rooms shall be ventilated according to the requirements in Chapter 4 of the California Mechanical Code.

Overall Inspection Comments

Shallow Pool:

- Flow 384gpm
- pH 7.7
- Chlorine 1.70ppm
- Temperature 82.5 F
- Cyanuric acid Low
- * Repair light as soon as possible.

Deep Pool

- Flow 589.1 gpm
- pH 7.5
- Chlorine 1.51ppm
- Temperature 84 F
- Cyanuric acid Lo



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME REDLANDS HIGH SCHOOL	DATE 8/18/2014	SIGNATURE
LOCATION 840 E CITRUS AV, REDLANDS, CA 92373		REHS Sierra Clayborn

Photo Attachments:

No Photo Attachments