



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME BAY MEADOWS RESORT					DATE 8/27/2014	SIGNATURE	
LOCATION 39774 BIG BEAR BL, BIG BEAR LAKE, CA 92315					REINSPECTION DATE Not Specified	PERMIT EXPIRATION 11/30/2014	
MAILING ADDRESS PO BOX 1522, BIG BEAR LAKE CA 92315					REHS Sierra Clayborn		
FA # FA0006790	PR # PR0015147	SR # Not Specified	CO # Not Specified	PE 3620	PROGRAM IDENTIFIER: Pool SERVICE: 001 - INSPECTION - ROUTINE		
TIME IN 11:40 AM	TIME OUT 12:10 PM	CONTACT Not Captured			RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ ACTION: 01 - NO FURTHER ACTION REQUIRED		




RECREATIONAL HEALTH - Public Pool - Initial Pool at Facility

Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

92

SCORE

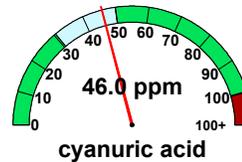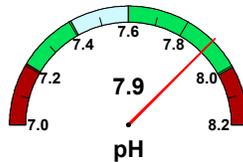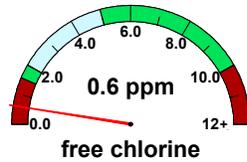

temperature (F)	67.0
observed flow (gpm)	100
required flow (gpm)	67
volume (gal)	24,000
area (sq ft)	800
occupancy	40

36K412 Water Quality - Non-Critical - Free/Combined Disinfectant Level

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed free chlorine at 0.60ppm.
	Not In Compliance	
	Violation Reference - CCR - 65529	Maintain free chlorine between 1.5ppm to 10ppm.

Violation Description: For pools using hypochlorite or gaseous chlorine without a stabilizer, a free chlorine residual at least 1.0 ppm shall be maintained throughout the pool. If cyanuric acid or a chlorinated isocyanurate is used, a free chlorine residual of at least 1.5 ppm shall be maintained throughout the pool. Combined chlorine/disinfectant shall not exceed approved level.

36K440 Enclosure - Non-Critical - Enclosure/Gates Non-Drowning Hazard

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed rear entrance to pool enclosure not completely self-closing and latching.
	Not In Compliance	
	Violation Reference - HSC - 3119B	Adjust spring IMMEDIATELY to allow door to self-close and self-latch.

Violation Description: The enclosure, doors and gates shall meet all requirements in the California Code of Regulations. Fencing/gates shall be maintained in good repair. Gates and doors shall open outwardly away from the pool except where otherwise prohibited by law. Gates and doors shall be capable of being locked during times when the pool is closed. The pool enclosure shall have at least one means of egress without a key for emergency purposes.

36K460 Skimmers - Requirements

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed spring valve missing from pool skimmer.
	Not In Compliance	
	Violation Reference - CCR - 65533, 3136B	Provide as soon as possible.

Violation Description: The pool shall be equipped with one or more skimming methods to provide continuous skimming of the pool water and shall be capable of continually withdrawing not less than 75 percent of the required flow rate. Skimmers and water levels shall be maintained and operated to remove floating scum, sputum or debris continuously. The skimmer shall be recessed into the pool wall, individually adjustable for the rate of flow with either an external or internal device, provided with an air lock protective device and provided with a removable and cleanable screen or basket to trap objects.

36K472 Access - Steps - Handrails - Diving Area

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed hand rail loose at 5ft end of pool.
	Not In Compliance	
	Violation Reference - CCR - 3111B, 3113B	Repair/tighten.

Violation Description: Stairs shall be provided in the shallowest portion of a pool. Ladders shall be corrosion resistant and shall be equipped with slip resistant tread surfaces. Ladders shall be rigidly installed. Hand rails shall be provided at the top of both sides of each ladder and recessed steps and shall extend over the coping or edge of the deck. Diving boards and platforms shall be anchored to the pool deck, constructed of corrosion resistant material, designed and constructed to be easily cleanable and finished with a durable slip resistant material.

Overall Inspection Comments



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME BAY MEADOWS RESORT	DATE 8/27/2014	SIGNATURE
LOCATION 39774 BIG BEAR BL, BIG BEAR LAKE, CA 92315	REHS Sierra Clayborn	

Recommend placing an additional 911 information sign near group of pool signs that has the name and address of pool facility and the number to the nearest emergency services in at least 1 inch font. Observed one sign near emergency phone that is on deck.

Photo Attachments:

No Photo Attachments