



County of San Bernardino • Department of Public Health
 Division of Environmental Health Services
COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME RANCHO PINO VERDE				DATE 9/11/2014	SIGNATURE <i>Ken M...</i>
LOCATION 11981 MIDWAY AV, LUCERNE VALLEY, CA 92356				REINSPECTION DATE Not Specified	PERMIT EXPIRATION 9/30/2014
MAILING ADDRESS 11981 MIDWAY AV, LUCERNE VALLEY, CA 92356				REHS John Ramos	
FA # FA0011577	PR # PR0013690	SR # Not Specified	CO # Not Specified	PE 3623	PROGRAM IDENTIFIER: Spa
TIME IN 9:34 AM	TIME OUT 10:11 AM	CONTACT Not Captured			SERVICE: 001 - INSPECTION - ROUTINE
					RESULT: 03 - CORRECTIVE ACTION / NO FOLLOW UP REQ
					ACTION: 01 - NO FURTHER ACTION REQUIRED

RECREATIONAL HEALTH - Public Pool - Additional Spa at Facility



Based on an inspection this day, the items marked below identify the violation(s) in operation or facilities which must be corrected. The Permittee has the right to a hearing if requested in writing within 15 calendar days of receipt of this notice, to show cause why the permit to operate should not be suspended or revoked.

Failure to correct listed violation(s) prior to the designated compliance date may necessitate an additional reinspection at a charge of \$61.25 per 15 minutes with a minimum time of 30 minutes, and a minimum charge of \$122.50.

90

SCORE

Ideal
In Compliance
Not in Compliance

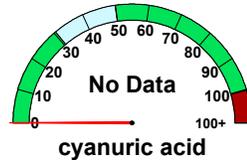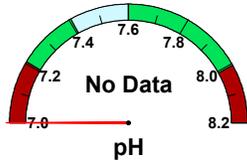

temperature (F)	No Data
observed flow (gpm)	No Data
required flow (gpm)	67
volume (gal)	2,000
area (sq ft)	70
occupancy	7

36K404 Water Quality - Critical - High Disinfectant Level



POINTS 4	Comply by: 9/25/2014	Inspector Comments: Observed chlorine above 50 ppm (used chlorine test strips to verify, approx 75 ppm). Maintain chlorine between 1.0 and 10.0. Corrected to 10 ppm.
	Complied on 9/11/2014	
Violation Reference - CCR - 65529		

Violation Description: Concentration of available disinfectant shall not exceed approved level. Free chlorine residual shall not exceed 10 ppm.

36K444 Equipment - Recirculation Pump/Filter/Separation Tank

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed faded directional arrows and markings on the piping. Provide markings.
	Not In Compliance	
Violation Reference - HSC - 3120B, 3132B, 3141B		
Observed leak at the filter and flow meter. Repair leak.		

Violation Description: Each pool shall be provided with a separate recirculation system designed for the continuous recirculation, filtration and disinfection of the pool water. The pumps, filters and all related parts of the pool water purification system shall be kept in operation whenever the pool is available for use. All parts of the pool and related pool facilities and equipment shall be maintained in good repair.

The backwash from a diatomaceous earth filter shall discharge into a separation tank. The wastewater from the separation tank shall discharge into a sanitary sewer or other disposal system acceptable to the local wastewater agency.

The direction of flow for the recirculation equipment shall be labeled clearly with directional symbols such as arrows on all piping in the equipment area.

36K448 Equipment - Flow Meter

POINTS 2	Compliance Date: Not Specified	Inspector Comments: Observed stuck flow meter. Repair or replace flow meter. The required flow is 67 GPM.
	Not In Compliance	
Violation Reference - CCR - 3125B		

Violation Description: A flow meter shall be provided on each recirculation system accurate to within 10 percent of flow. Flowmeter shall be maintained in good repair, accurately displaying flowrate.



**COMMUNITY ENVIRONMENTAL HEALTH PROGRAM
RECREATIONAL HEALTH - OFFICIAL INSPECTION REPORT**

www.sbcounty.gov/dph/dehs

(800) 442-2283

FACILITY NAME RANCHO PINO VERDE	DATE 9/11/2014	SIGNATURE 
LOCATION 11981 MIDWAY AV, LUCERNE VALLEY, CA 92356		REHS John Ramos

36K482 Restrooms - Toilet Facilities - Showers - Drinking Fountain

POINTS 2	Compliance Date: Not Specified	Inspector Comments:
	Not In Compliance Violation Reference - CCR - 65535, 65551, 3117B	

Violation Description: Toilets, urinals, showers, wash basins and other plumbing fixtures shall be maintained in a clean condition, and in good repair. For shower, toilet and dressing facilities, the walls, partitions, doors, lockers and similar surfaces which require periodic cleaning shall be maintained smooth and finished so as to facilitate cleaning. Showers shall be provided with soap in soap dispensers or containers. For toilet facilities, handwashing detergent or soap, sanitary towels or hot air blowers, and toilet tissues shall be provided in permanently installed dispensing devices. Showers and lavatories shall be provided with hot and cold water faucets.

One guarded jet drinking fountain shall be provided for the first 250 bathers and an additional fountain shall be provided for each additional 200 bathers or fraction thereof.

Overall Inspection Comments

Correct the above noted violations.

Pool is currently closed due to the lack of a qualified lifeguard at the facility.

If you have any questions contact John Ramos at (800) 442-2283.
Our office has moved to 15900 Smoke Tree Street, Hesperia, CA 92345.

Photo Attachments:
No Photo Attachments